REPORT #442453





Starting with the exterior of the vehicle. There are multiple dings all around this vehicle with the majority being on the roof and hood. The vehicle has been repainted and the work is substandard. There are multiple spots where sanding marks can be seen and paint readings were higher than normal. Multiple spots have started to peel and chip. The door seals are weather and aged. The passenger door seal is falling off. The lights all looked okay. There was no frame damage found on the vehicle. The left rocker was bent. There is a dent on the right fender. There are multiple dings on the chrome trim. Rust is starting to come through the paint in multiple sots.

Next for the interior of the vehicle. Multiple trim panels are missing. The radio and a/c-heater system are not present but some of the ducting is. There are wires hanging down from the dash, The gauges for the vehicle work. The gear shifter did not have a knob. All of the seats have stains on them and are aged. The steering wheel wrap is falling off and extremely worn. The dash is severely worn and some spots are peeling. There are no window cranks and would have to be operated with vice grips.

Next for the wheels and tires. All of the tires have at least 7/32" which is good. All of the wheels have corrosion and scratches on them and the front right wheel has curb rash.

Next for the mechanical and test drive. There was not a test drive performed due to the condition the vehicle was in. The vehicle did start with no issue but the idle is rough. The accelerator spring for the vehicle is stretched out and partially attached to the a/c compressor. The A/C compressor does not have belts attached to it. The emergency brake was not working at the time. The only part that was noticed that was leaking is transmission fluid started to gather on the housing.

Please see below for picture and more info.

Vehicle Info		Mechanical	
Year - 1968		Air Filter	 ✓
Make - Ford		Battery Condition	~
Model - Mustang		Charging System	· ·
Mileage - 56385		Cooling Fan Condition	· ·
Transmission - Manual		Radiator Cap Sealing Properly	~
VIN Number - 8F01C175601		Hoses	~
Interior - Leather		Radiator	×
Interior Color - Tan		The radiator is in good working condition but looks aged.	~
		Engine Coolant	~
Body Color - Green		Coolant Leaks	~
Engine - 8 Cylinder		Belts	~
Drive Type - Rear Wheel Drive			-
Fuel Type - Gas		Engine Oil	~
		Engine Fluid Leaks	~
Exterior		Transmission Fluid	~
		Transmission Leaks	X
Wiper Blades	~	Transmission fluid gathering on transmission. Can be seen in p	
Windshield Washer	×	Brake System	~
Windshield washer was not operable and hoses were not conn		Brake Fluid Leaks	~
Body Alignment	~	Transfer Case Leaks	~
Scratches	×	Differential leaks	~
There are minor misc scratches around the vehicle. Normal for	r mileage	Muffler System	×
and most too small to see in photos.		Exhaust shows some surface rust throughout, but at this time h	as no
Dings Multiple dings across entire body with a good majority on the ro	X	leaks and sounds good.	
hood.		CV Joints and Axles	~
Dents	X	Shocks and bushings	~
There is a dent on the right fender.		Ball Joints and Tie Rods	~
Paint Condition	X	Modifications	~
Roof looks wavy and has been repainted. Hood has been repa			
is substandard. Both quarter panels have been repainted and a		Road Test	
substandard. The vehicle repaint shows dust under the paint, s			-
orange peel, and signs of poor prep. This is sub-par workmans		Road Test	X
There are multiple spots where the pint is starting to peel and o	chip away	With condition that the vehicle was in, it was not driven but, it do	oes start
as well as spots of rust starting to come through the paint. Body Seals		and idled but the idle was a little rough. Engine Performance	
Passenger door seal is falling off. Both door seals are weather	×	Idle was rough. Spring for accelerator is stretched out and attac	X
Rust	x	the a/c compressor.	
Rust on right quarter panel. The underside shows areas of mind		Engine Starting	v
rust. See pictures.			•
Exterior Lights	~	TIRESe/WHEELS	
Door Mirrors	· ·	Spare Tire	×
Bumpers	×	No spare tire found with vehicle.	
Scratches on the curve of the front bumper.		Tire Manufacturer	
Frame Damage	~	Driver's Front - Cooper	
Glass	· ·	Passenger's Front - Cooper	
Body Filler?	×	Driver's Rear - Cooper	
Right quarter panel has had a significant amount of work done		Passenger's Rear - Cooper	
	and paint	Tire Size	
meter could not get a reading. Hood	X		
		Driver's Front - 195/75/14 Passenger's Front - 195/75/14	

multiple dings across hood.	
Doors	X
Both doors have multiple dings and have been repainted which is substandard.	;
Floors	~
Rockers	X
Left rocker is bent.	
Quarter Panels	×
Both quarter panels have been repainted and the work is substar	ndard.
Chrome	X
Chrome strips have multiple dings on them	

Interior	
Steering Wheel	x
Severe wear on steering wheel. Leather wrap falling off.	
Horn	~
Seat Condition	X
Both front seats have wear and stains on them. rear bench is weat	hered
from the sun and stained	
Seat Belts	~
Radio/Navigation	X
Radio missing and wires hanging down from dash	
Inner Door Panels	X
Normal wear for the vehicles age but has some blemishes	
Window Function	X
No window cranks and had to be operated with vice grips	
Dash	X
Heavily weathered and peeling,	
Sun Visors	~
Dash Lights	~
Dash Gauges	~
Air Conditioning	X
A/C system not operable and multiple pieces missing. Belt not runn	ning
on compressor.	
Heater	X
Heating system not operable and multiple pieces missing.	
Carpet	~
Floor Mats	X
Floor mats missing	
Cigarette Use	~
Unusual Odors	~
Cup Holders	~
Headliner	~
Blower Motor	X
There was no blower attached.	
Interior Trim	X
Multiple trim pieces missing throughout interior.	
Inner Trunk	~

Driver's Rear - 195/75/14	
Passenger's Rear - 195/75/14	
Tire Condition	
Driver's Front - No Issues	
Passenger's Front - No Issues	
Driver's Rear - No Issues	
Passenger's Rear - No Issues	
Wheel Condition	
Driver's Front - Corrosion, Scratches	
Passenger's Front - Curb Rash, Corrosion	
Driver's Rear - Corrosion, Scratches	
Passenger's Rear - Corrosion, Scratches	
Tire Tread	
Driver's Front - 7/32	
Passenger's Front - 7/32	
Driver's Rear - 7/32	
Driver's Rear - 7/32 Passenger's Rear - 7/32	
	10/32 OR MORE
	10/32 OR MORE Tires have plenty of
	Tires have plenty of
	Tires have plenty of tread!
	Tires have plenty of tread! (standard)
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread!
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread! (low profile)
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread!
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread! (low profile) 5/32 TO 7/32 Tires will need
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread! (low profile) 5/32 TO 7/32 Tires will need replacement soon!
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread! (low profile) 5/32 TO 7/32 Tires will need
	Tires have plenty of tread! (standard) 8/32 OR MORE Tires have plenty of tread! (low profile) 5/32 TO 7/32 Tires will need replacement soon!










































































































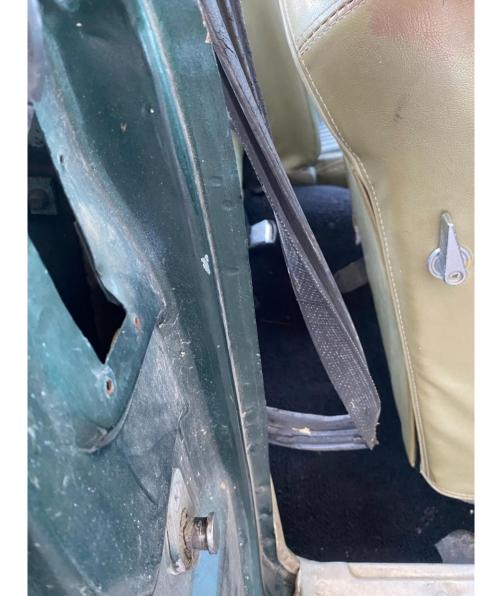























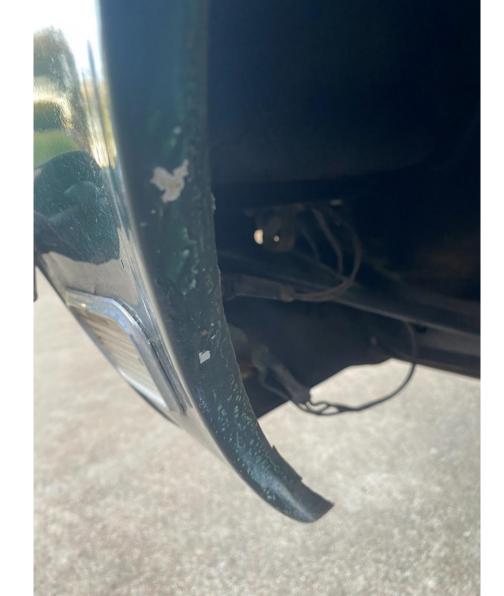

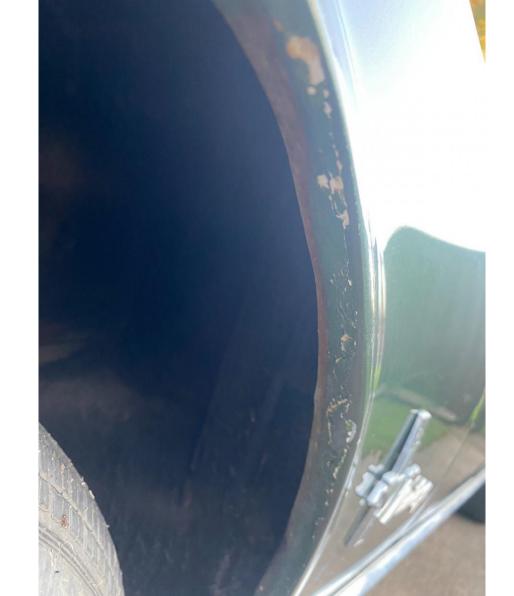































































































Je





























