

Report #484436

1974 Porsche 914



## Summary

Inspected this vehicle at the seller's residence.

The exterior shows multiple and poor paint touch ups. There are some spots by the antenna plug on the left fender. There is a crack and bubbling is evident underneath the paint. The plug covers the opening but not the indentation left by the prior antenna base. The vinyl covering on the sail panels has minor bubbling underneath. There is a long black mark on the panel behind the rear window. The right quarter panel also has bubbling evident on top by the door. The windshield reveal molding has scratches from a DA sander and is oxidized. The left retractable headlamp raises but didn't retract when commanded by the light switch. The right sealed beam headlamp is inoperative. There is a box in the frunk containing a replacement lamp. The edges of the headlamp lids are worn and not completely painted. The right door is out of alignment and the door requires additional effort to open and close at the latch. The hinges do not seem to have any play. The left door open and closes properly. The liftoff top removes and installed easily. The exterior rubber trim is deteriorating. The tail lamps are not original US spec.. There is an aftermarket reflective filler panel that inhibits the ability to open the trunk lid. The engine panel opens and closes properly. The paint meter readings vary all around. There is evidence of body filler throughout but nothing substantial. The body panels are straight which is difficult to accomplish without some usage of body filler. The paint is aging but still presentable from about 10 feet away. The amount of scratches, chips along with the poorly touched up paint really bring the vehicle down when viewed up close. Given the amount of touch ups and chips, the vehicle really needs to be repainted. The underside has undercoating. No apparent rot seen. The frunk carpet is glued down. There is a later model temporary spare tire mounted in the frunk. The seller states he has converted to 911 spec 5 lug wheels. The lower bumper cover is damaged.

The interior shows some wear and tear. The dash vinyl is loose and rippled especially at the windshield base. The seller has removed the radio and installed a block off panel that matches the dash fabric pattern. The heater blower doesn't operate. The slides on the heater panel are difficult to move. The seats show some wear and the driver seat headrest material is torn. The covers are warped. There are some splits and tears in the back panel cushion that is behind the seats. The seat belts are original and the right retractor is stiff to operate. The windows roll up and down without any issues. The windshield washer system has been eliminated with the exception of the nozzles. The seller states he has the system in a box. The wipers operated. The vinyl around the shifter base is cut improperly. The center console is intact. The liftoff panel interior trim is in good condition. The rubber trim is deteriorating. The sun visors are warped and aged. The passenger side mirror is broken. The rear trim on the top rear of the window at where the liftoff panel sits is damaged and warped. The carpet and floor mats are newer. The clock doesn't work. The upper left temperature gauge doesn't work. The oil temperature gauge doesn't work.

The seller drove. The vehicle appears to track straight. The suspension rode well without any issues when hitting bumps. The brakes seemed to respond well, no pulling or vibration noted. The engine runs well without any unusual noises or smoke noted. The transmission didn't make any unusual noises. The shifter appears to operate smoothly. The clutch didn't slip or chatter.

The tires appear to be in good condition but wear 2010 date codes. NHTSA recommended replacement is due at 5 years.

Overall, this seems to be in good driver quality condition.











## Vehicle Information

Year	1974
Make	Porsche
Model	914
VIN	4742920808
Stock No.	n/a
Mileage	84627
Engine Cylinders	4 Cylinder
Exterior Color	Blue
Interior Color	Black
Interior Material	Vinyl
Engine Number	n/a
Transmission Number	n/a
Fuel Type	Gas

## Drivetrain

Transmission	Manual
Drive Type	Rear Wheel Drive

## Road Test

Road Test	 Good
Engine Starting Easily	 Good
Engine running well after Started	 Good
Transmission performance	 Good
Clutch Performance	 Good
Differential Performance	 Good
Wheel Bearing Performance	 Good
Braking Performance	 Good
Suspension Performance	 Good
Steering Performance and Alignment	 Good

## Exterior

Wiper Blades	Issues
Unable to tell, washers inoperative	
Windshield Washer	Issues
The windshield washer does not work. System is in a box according to the seller.	
Body Panel Alignment	Issues
Some panels misaligned especially the hood to fender gaps.	
Scratches	Issues
There are minor misc scratches around the vehicle. Normal for mileage and most too small to see in photos.	
Paint Condition	Issues
Multiple poor touch ups on chips and scratches that ultimately will require a total strip and repaint.	
Seals	Issues
The body seals around the windows are showing signs of age and wear. This includes the doors, windows, trunk, and other miscellaneous body seals. They will need replacement.	
Rust	Issues
The underside shows areas of minor surface rust. See pictures.	
Exterior Lights	Issues
R headlamp inoperative. L headlamp door inoperative when commanded to go down. Non US spec tail lamps.	
Power Sunroof	Good
Power Door Mirrors	Good
Bumpers	Issues
Damaged in front lower. Dings in rear chrome face. Over tightening on left retainer has bent the bumper.	
Underbody/Frame Condition	Good
Glass	Issues
The windshield has miscellaneous stone chips.	
Floors	Good
Rockers	Good

## Interior















Steering Wheel	Issues
The steering wheel shows some wear and tear as seen in pics.	
Horn	Good
Seat Condition	Issues
The seats show moderate wear. Headrest torn on driver seat.	
Seat Belts	Issues
Aged, right difficult to pull in and out.	
Clock	Issues
The clock does not work.	
Inner Door Panels	Issues
The inner door panels show wear consistent with age and mileage.	
Center Console	Issues
The center console shows wear and tear. See pictures.	
Dash	Issues
The dash is showing wear and tear. The vinyl covering is wrinkled and warped.	
Dash Lights Working	Issues
The dash lights do not appear to be working, but it was a bright day. They should be checked when its darker.	
Heater	Issues
The heater system has been bypassed so the heater does not produce any heat.	
Carpet	Issues
The carpet shows normal wear consistent with age and mileage.	
Floor Mats	Good
Signs of Smoking?	Good
Headliner	Good
Blower Motor	Issues
The blower motor does not work.	
Instrument Cluster/Gauges	Issues
Some of the dash gauges are not working. Oil temperature and left temperature gauge	



	<div></div>
Quarter Panels	<div></div> Good
Body Filler Used	<div></div> Issues
I checked the vehicle with a paint meter. Not excessive.	
Hood	<div></div> Issues
Doesn't stay open, springs are weak.	
Doors	<div></div> Issues
R door difficult to open and close.	
Dings	<div></div> Issues
Left door ding	
Dents	<div></div> Good
Chrome	<div></div> Issues
The chrome is pitted and wearing due to age.	

temperature, and rent temperature gauge.	
Unusual Odors	<div></div> Good
Window Function	<div></div> Good
Interior Trim	<div></div> Issues
Torn, warped and aged.	
Sun Visors	<div></div> Issues
The sun visors show wear and tear. They are warped. Mirror is broken.	

## Mechanical

Air Filter	 Good
Battery Condition	 Good
Charging System	 Good
Belts	 Issues
Belt is showing wear and cracking from age.	
Engine Oil Condition	 Good
Engine Oil Leaks	 Good
Transmission Fluid Leaks	 Good
Brake System Condition	 Good
Brake Fluid Leaks	 Good
Differential leaks	 Good
Muffler System	 Good
CV Boots and Joints	 Good
Shocks and bushings Condition. Leaking?	 Good
Ball Joints and Tie Rods	 Good

## Tire / Wheels

Manufacturer	
Driver's Front Tire	Fierce
Passenger's Front Tire	Fierce
Driver's 1st Axle Outer Tire	Fierce
Passenger's 1st Axle Outer Tire	Fierce
Size	
Driver's Front Tire	205/55/16
Passenger's Front Tire	205/55/16
Driver's 1st Axle Outer Tire	205/55/16
Passenger's 1st Axle Outer Tire	205/55/16
Tire Condition	
Driver's Front Tire	No Issues
Passenger's Front Tire	No Issues
Driver's 1st Axle Outer Tire	No Issues
Passenger's 1st Axle Outer Tire	No Issues
Wheel Condition	
Driver's Front Tire	Scratches
Driver's 1st Axle Outer Tire	Scratches
Passenger's Front Tire	Scratches
Passenger's 1st Axle Outer Tire	Scratches
Tire Tread	
Driver's Front Tire	7/32
Passenger's Front Tire	7/32
Driver's 1st Axle Outer Tire	7/32
Passenger's 1st Axle Outer Tire	8/32
Spare Tire	
	Yes



## Vehicle Images

































Ding













































































PRESS

VOID ON PLACA

# Texas Liability Insurance Card

Agent: Hagerty Insurance Agency, LLC  
Company: Essentia Insurance Company

Named Insured: Ronald Paul Davis  
Elvin Davis  
4602 Kyleleaf Ln.  
McKinney TX 75072-5275

Phone: (800) 822-4680  
Phone: (800) 236-2862

Vehicle Year: 1974  
Vehicle ID Number: 4742920808

Policy Number: 1N91994  
Effective: 07/14/2007  
Expiration: 07/14/2008  
Model: 914

This policy provides at least the minimum amounts of liability insurance required by the Texas Motor Vehicle Safety Responsibility Act for the specified vehicles and named insureds and may provide coverage for other persons and vehicles as provided by the insurance policy.

DO NOT REMOVE FROM VEHICLE  
CALIFORNIA DRIVER'S LICENSE REQUIRED TO OBTAIN THIS CARD

## Liability Insurance Card

PEEL

See back of card for other important information

019  
2020
























































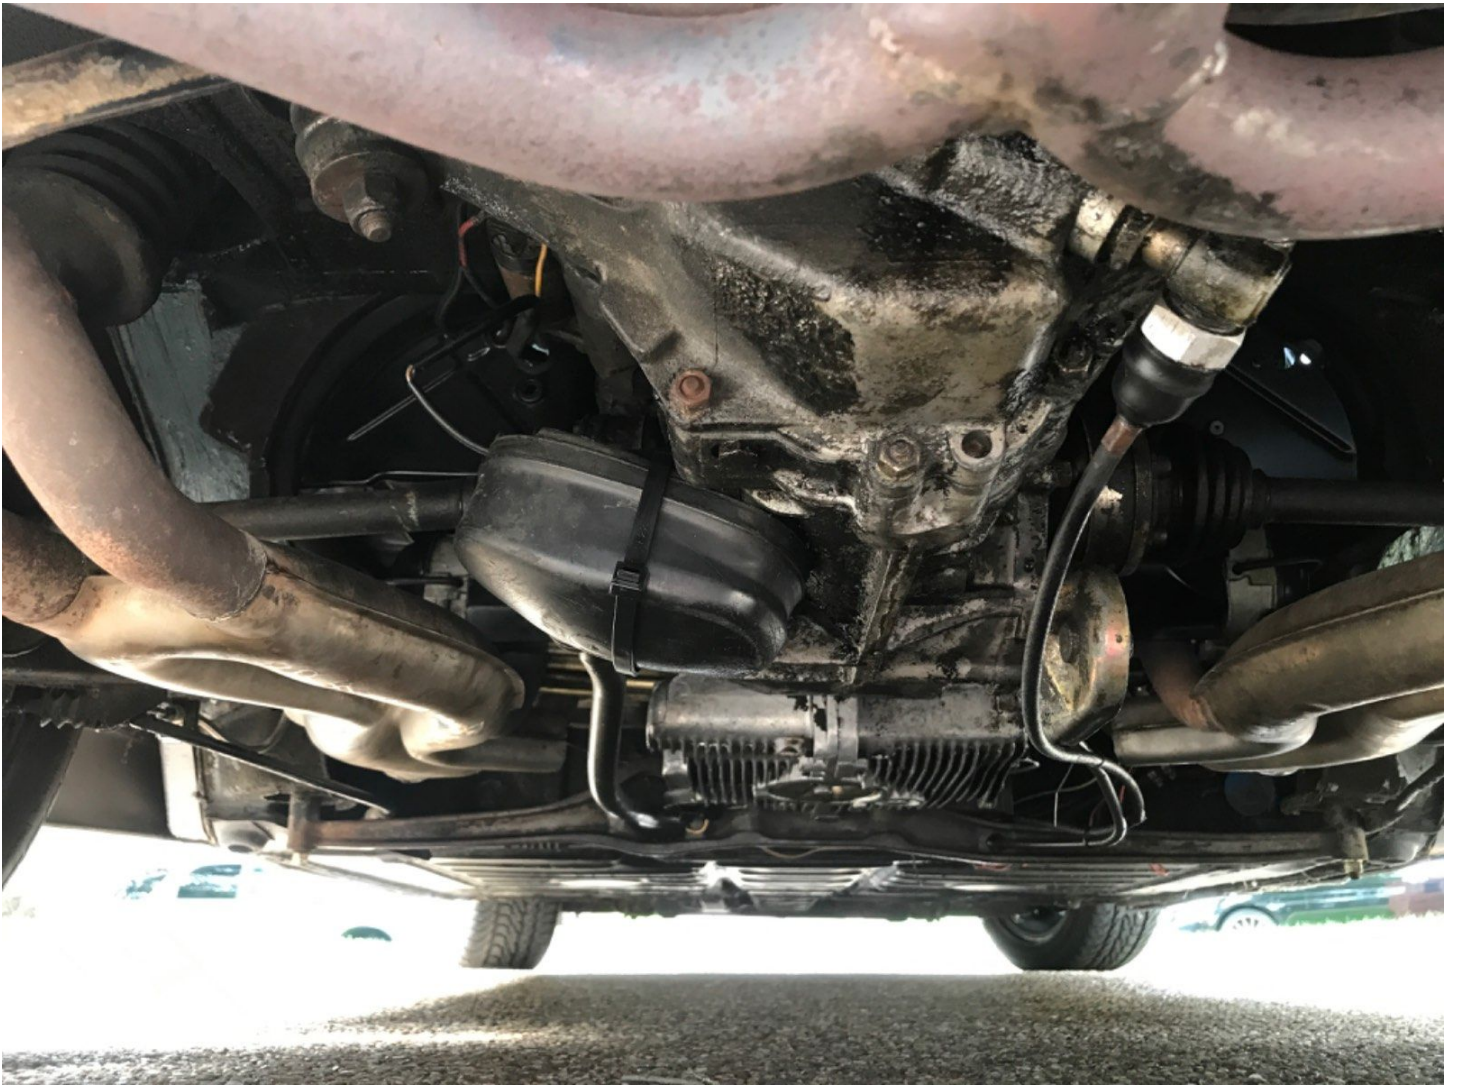
















































































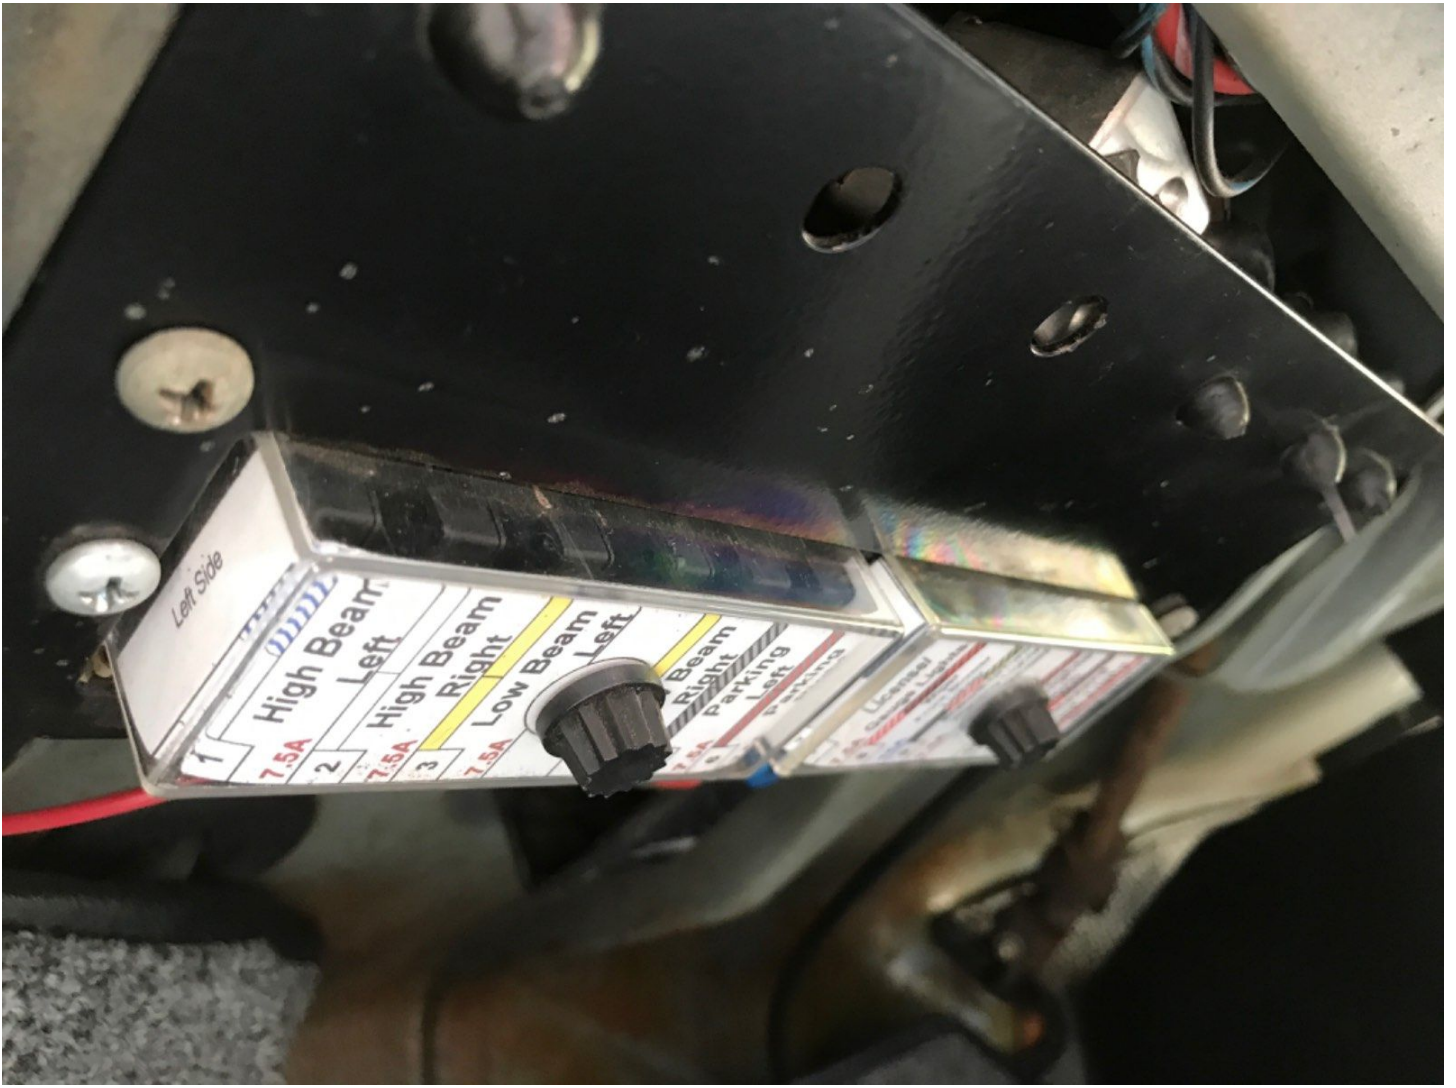
















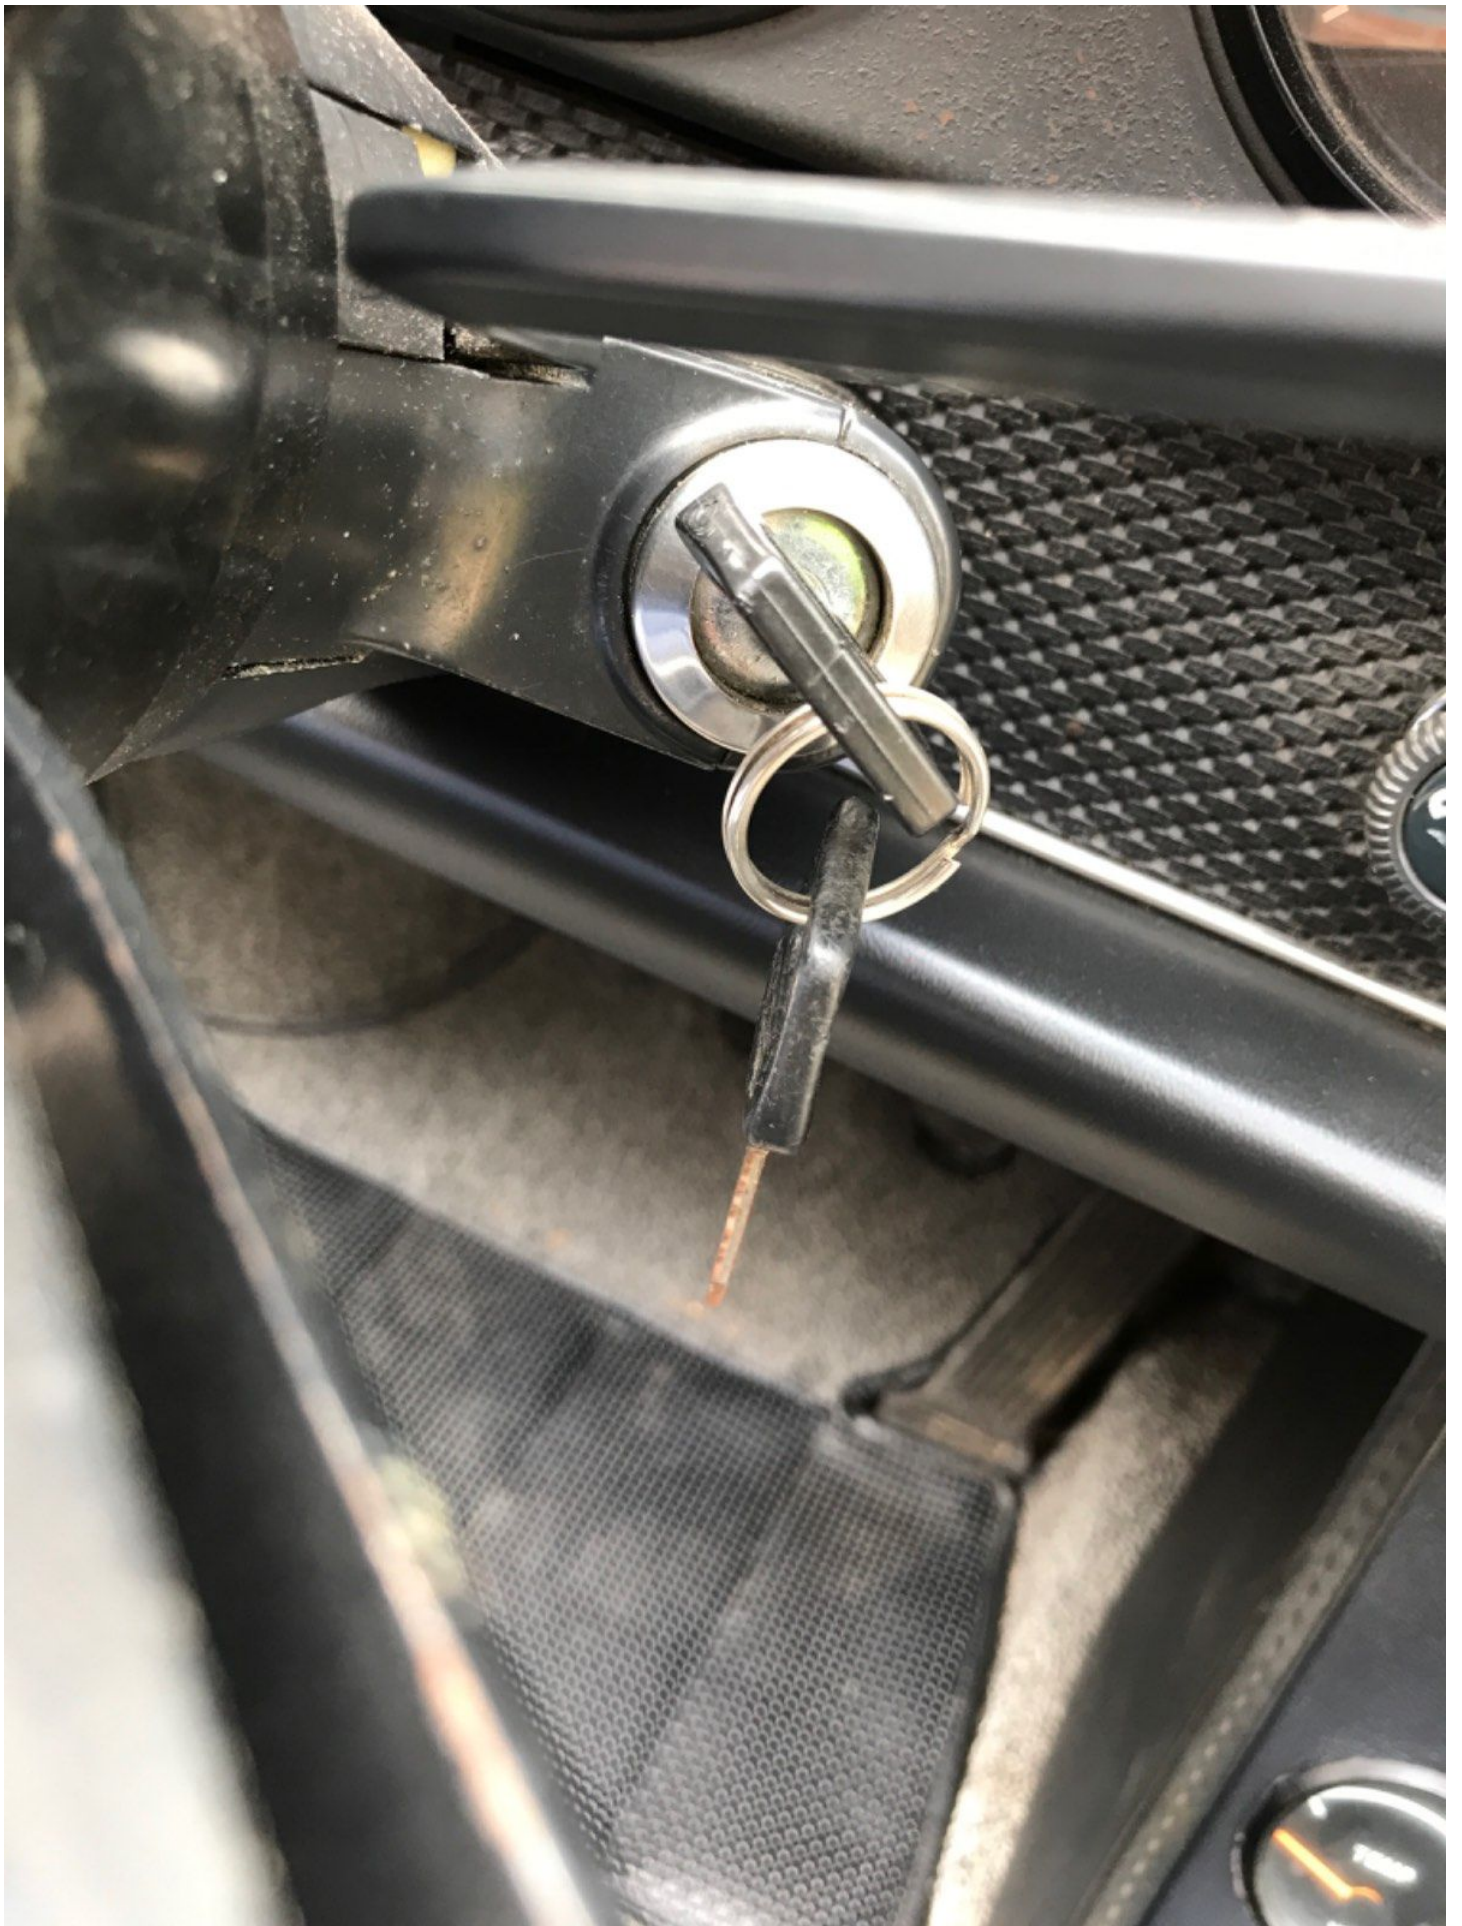































MADE IN  
WESTERN GERMANY

**KARMANN**

KAROSSERIE

NR. 739562

KUNSTHARZLACK

L 96 M































































































































































































































































































VOLKSWAGENWERK AG  
MADE IN GERMANY

Typ 47

Heizg. Typ 4/255 A Prüfz. mm S 96

00

Fahrgest.-Nr. 474 2920806

Zul. Gesamtgewicht kg 1220

Zul. Achslast vorn kg 650 hinten kg 650



VOLKSWAGENWERK AG  
MADE IN GERMANY

Typ 47

Heizg. Typ 4/255 A Prüfz. mm S 96

03

Fahrgest.-Nr. 474 2920806

Zul. Gesamtgewicht 1220

Zul. Achslast vorn kg 650 hinten kg 650























































