

1937 Pontiac Deluxe Sedan



This 1937 Pontiac Deluxe Sedan is in good running and driving condition with a few flaws to note.

Exterior

This vehicle has many dings, most of which have been filled or repaired. There are some runs notable in the paint. The repaint is otherwise good quality and shines nicely. The underside shows areas of minor surface rust. See pictures. The exterior lights are not operable, as they are not wired up. The front bumper is missing. The body seals around the windows are showing signs of age and wear. This includes the doors, windows, trunk, and other miscellaneous body seals. They will need replacement. The vehicle shows heavy body filler used throughout the exterior. The chrome is pitted and wearing due to age. All four wheels are in good condition with no curb rash or corrosion notable. The tires show 10/32nds of tread remaining, and even wear throughout.

Interior

The windows do not have handles, therefore cannot be tested. The carpet is dirty and discolored from use. The inner trunk shows areas of minor surface rust. The interior trim and upholstery are in good condition with little to no wear to note, though the interior is overall dusty and dirty. All of the interior functions, controls, and accessories not yet noted are operating as designed. There were no odd smells in the vehicle at the inspection, and this is a non-smoker vehicle.

Test Drive

I found no issues on the test drive. The engine had plenty of power and there were no misfires or smoking. The transmission shifted as designed with no harsh engagement or slipping. The steering was responsive and the suspension was firm and the vehicle handled well. There were no abnormal vibrations or odd noises. The brakes were firm with no pulsation felt. There were no leaks found to

the underside of the vehicle. All of the gauges appeared accurate and operational. See below and pictures for more info.

Vehicle Info	
Year - 1937	
Make - Pontiac	
Model - Deluxe Sedan	
Mileage - 76	
Transmission - Automatic	
VIN Number - 230100	
Interior - Cloth	
Interior Color - Red	
Body Color - Maroon	
Engine - 8 Cylinder	
Drive Type - Rear Wheel Drive	
Fuel Type - Gas	
Engine Number - 355	
Transmission Number - Turbo400 with shift kit	

Exterior	
Body Alignment	✓
Scratches	✓
Dings	✗
This vehicle has many dings, most of which have been filled or repaired.	
Dents	✓
Paint Condition	✗
There are some runs notable in the paint. The repaint is otherwise good quality and shines nicely.	
Body Seals	✗
The body seals around the windows are showing signs of age and wear. This includes the doors, windows, trunk, and other miscellaneous body seals. They will need replacement.	
Rust	✗
The underside shows areas of minor surface rust. See pictures.	
Exterior Lights	✗
The exterior lights are not operable, as they are not wired up.	
Door Mirrors	✓
Bumpers	✗
The front bumper is missing.	
Side Moldings	✓
Frame Damage	✓
Glass	✓
Body Filler?	✗
The vehicle shows heavy body filler used throughout the exterior.	
Hood	✓
Doors	✓
Floors	✓
Rockers	✓
Quarter Panels	✓
Chrome	✗
The chrome is pitted and wearing due to age.	

Interior	
Steering Wheel	✓
Seat Condition	✓
Seat Belts	✓
Inner Door Panels	✓
Window Function	✗
The windows do not have handles, therefore cannot be tested.	

Mechanical	
Air Filter	✓
Battery Condition	✓
Charging System	✓
Cooling Fan Condition	✓
Radiator Cap Sealing Properly	✓
Hoses	✓
Radiator	✓
Engine Coolant	✓
Coolant Leaks	✓
Belts	✓
Engine Oil	✓
Engine Fluid Leaks	✓
Transmission Fluid	✓
Transmission Leaks	✓
Brake System	✓
Brake Fluid Leaks	✓
Differential leaks	✓
Muffler System	✓
Shocks and bushings	✓
Ball Joints and Tie Rods	✓
Modifications	✓

Road Test	
Road Test	✓
Engine Performance	✓
Transmission performance	✓
Differential Performance	✓
Wheel Bearing Performance	✓
Braking Performance	✓
Suspension Performance	✓
Steering Performance	✓
Engine Starting	✓

TIRES/WHEELS	
Spare Tire	✗
No spare tire found with vehicle.	

Tire Manufacturer	
Driver's Front - Hankook Ventus	
Passenger's Front - Hankook ventus	
Driver's Rear - Hankook ventus	
Passenger's Rear - Hankook ventus	

Tire Size	
Driver's Front - 215/60/r15	
Passenger's Front - 215/60/r15	
Driver's Rear - 265/50/r15	
Passenger's Rear - 265/50/r15	

Tire Condition	
Driver's Front - No Issues	
Passenger's Front - No Issues	
Driver's Rear - No Issues	
Passenger's Rear - No Issues	

Wheel Condition	
Driver's Front - No Issues	

Dash	✓
Sun Visors	✓
Dash Lights	✓
Dash Gauges	✓
Carpet	✗
The carpet is dirty and discolored from use.	
Floor Mats	✓
Cigarette Use	✓
Unusual Odors	✓
Headliner	✓
Interior Trim	✓
Inner Trunk	✗
The inner trunk shows areas of minor surface rust.	

Passenger's Front - No Issues
Driver's Rear - No Issues
Passenger's Rear - No Issues
Tire Tread
Driver's Front - 10/32
Passenger's Front - 10/32
Driver's Rear - 10/32
Passenger's Rear - 10/32



10/32 OR MORE

Tires have plenty of tread!
(standard)

8/32 OR MORE

Tires have plenty of tread!
(low profile)

5/32 TO 7/32

Tires will need replacement soon!

4/32 OR LESS

Tires need replacement!

1



2



3
































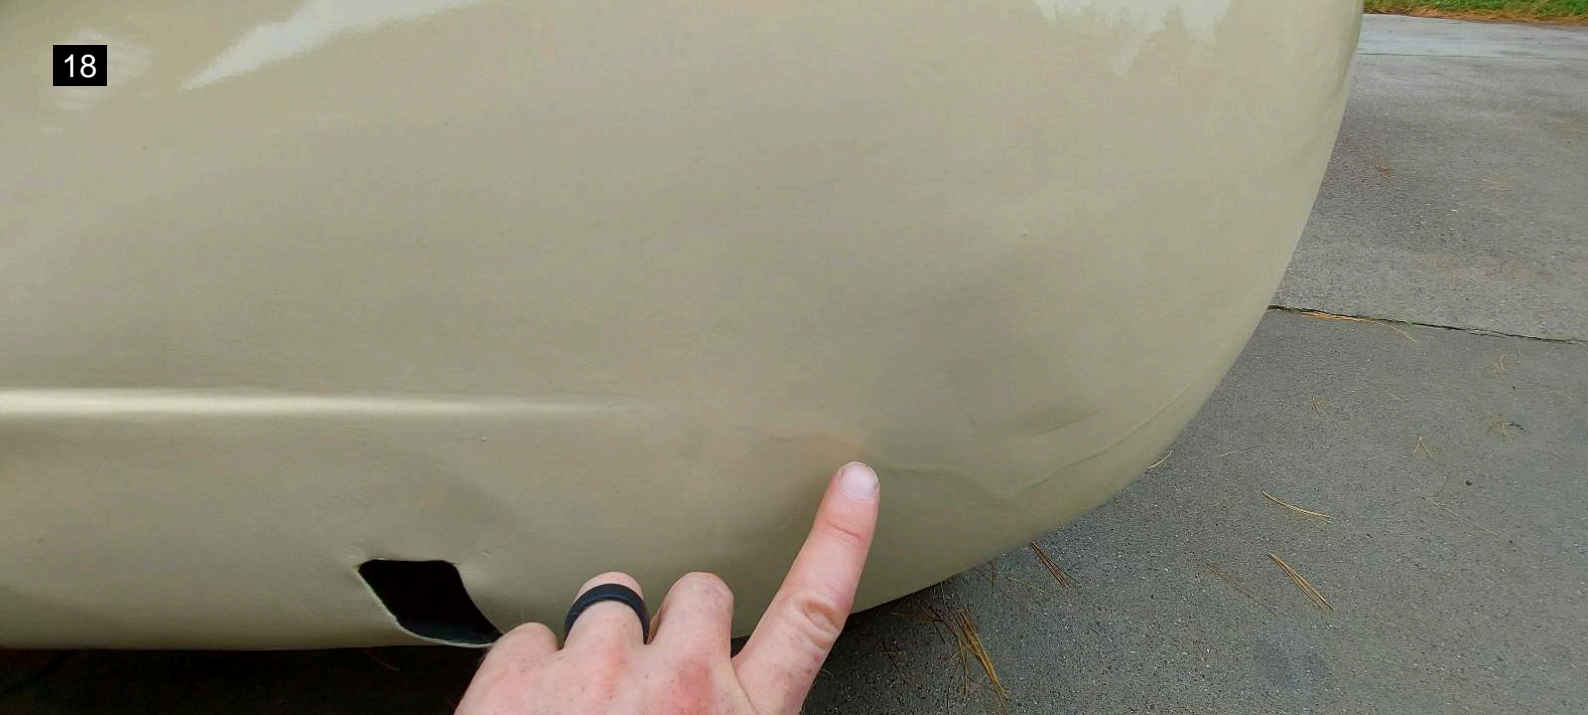










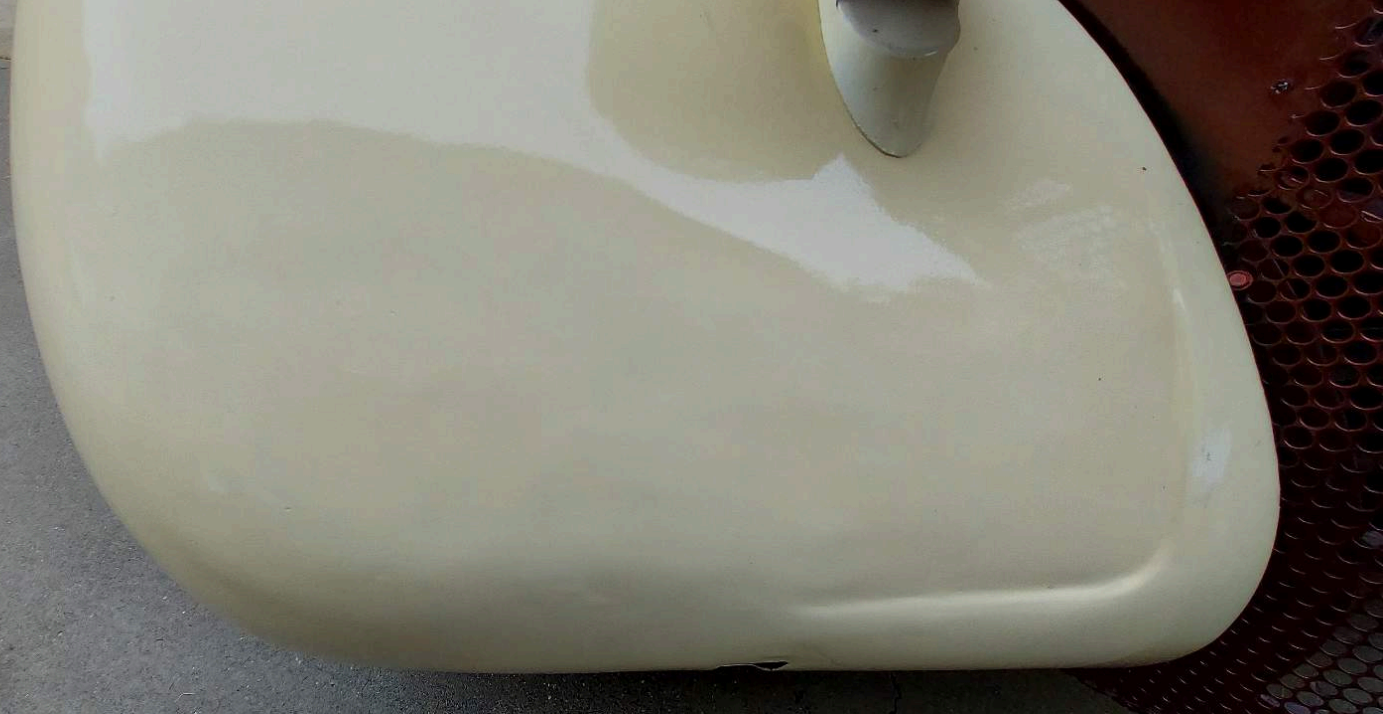







27



























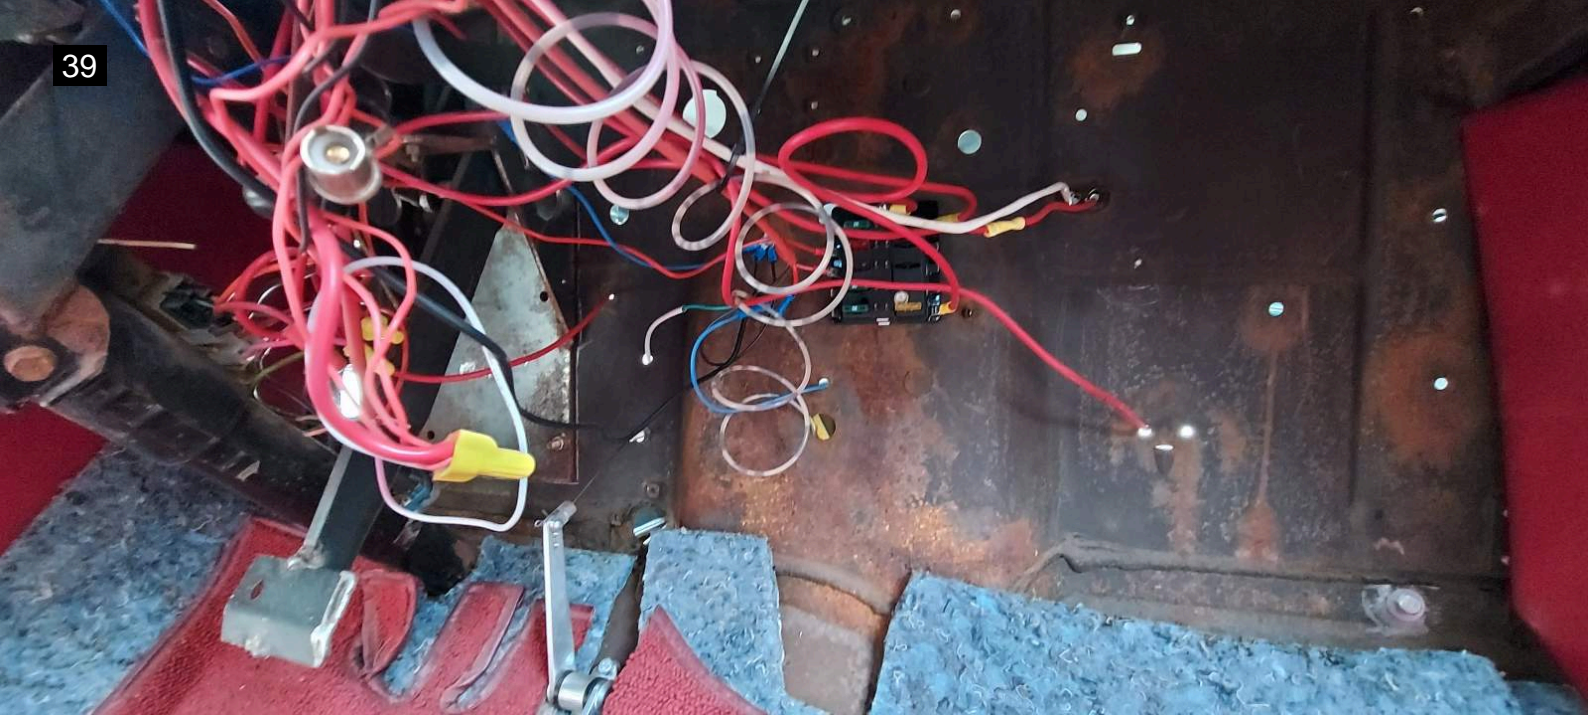

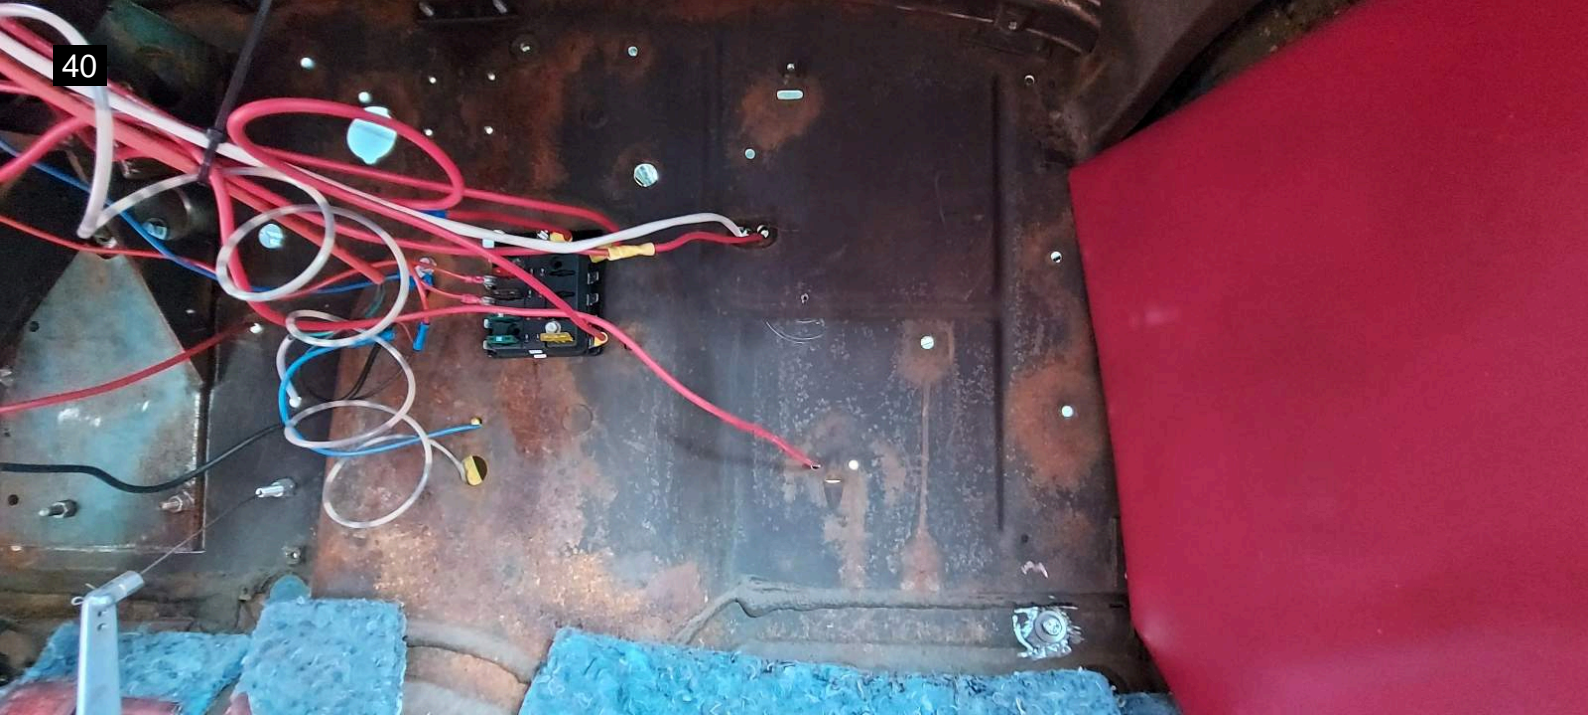

































57



























70








































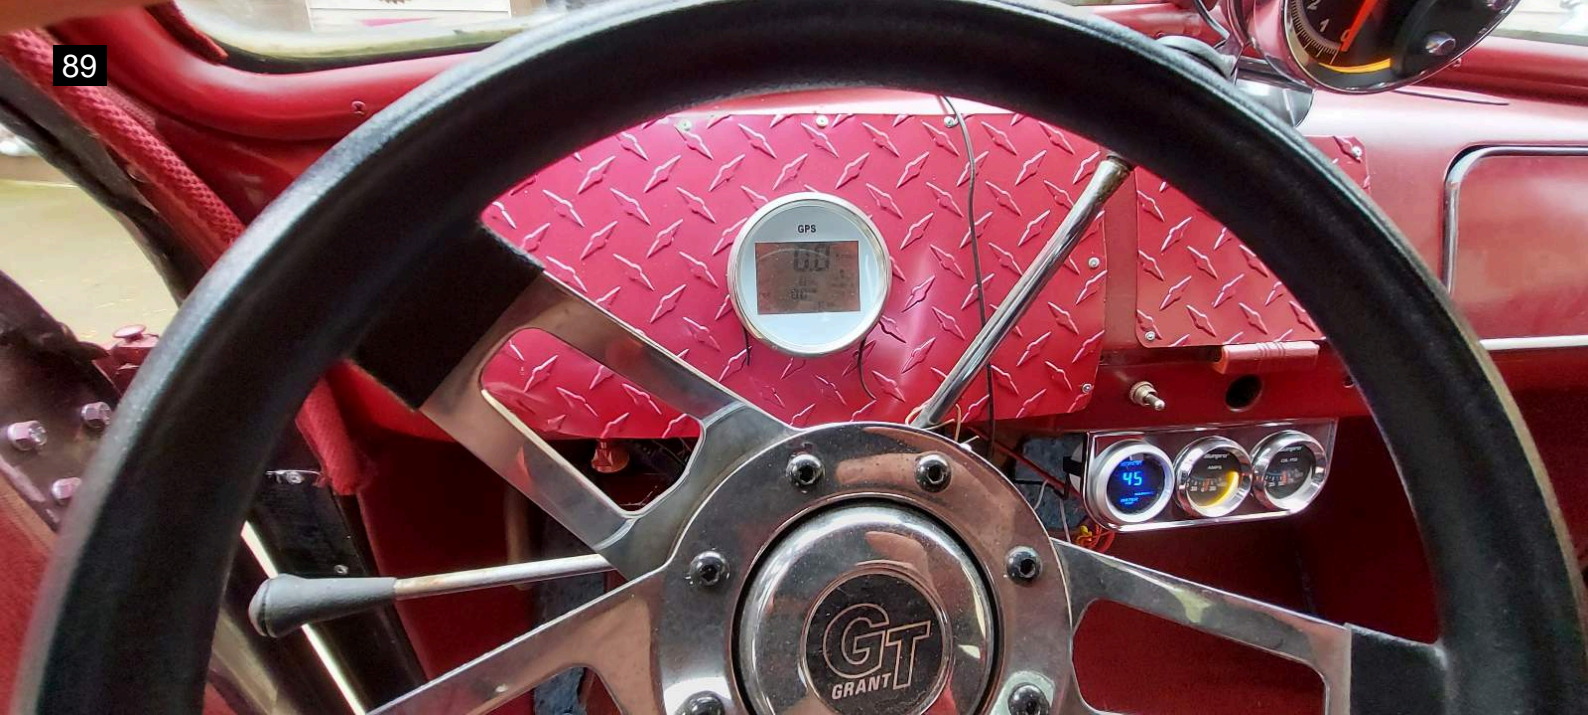




















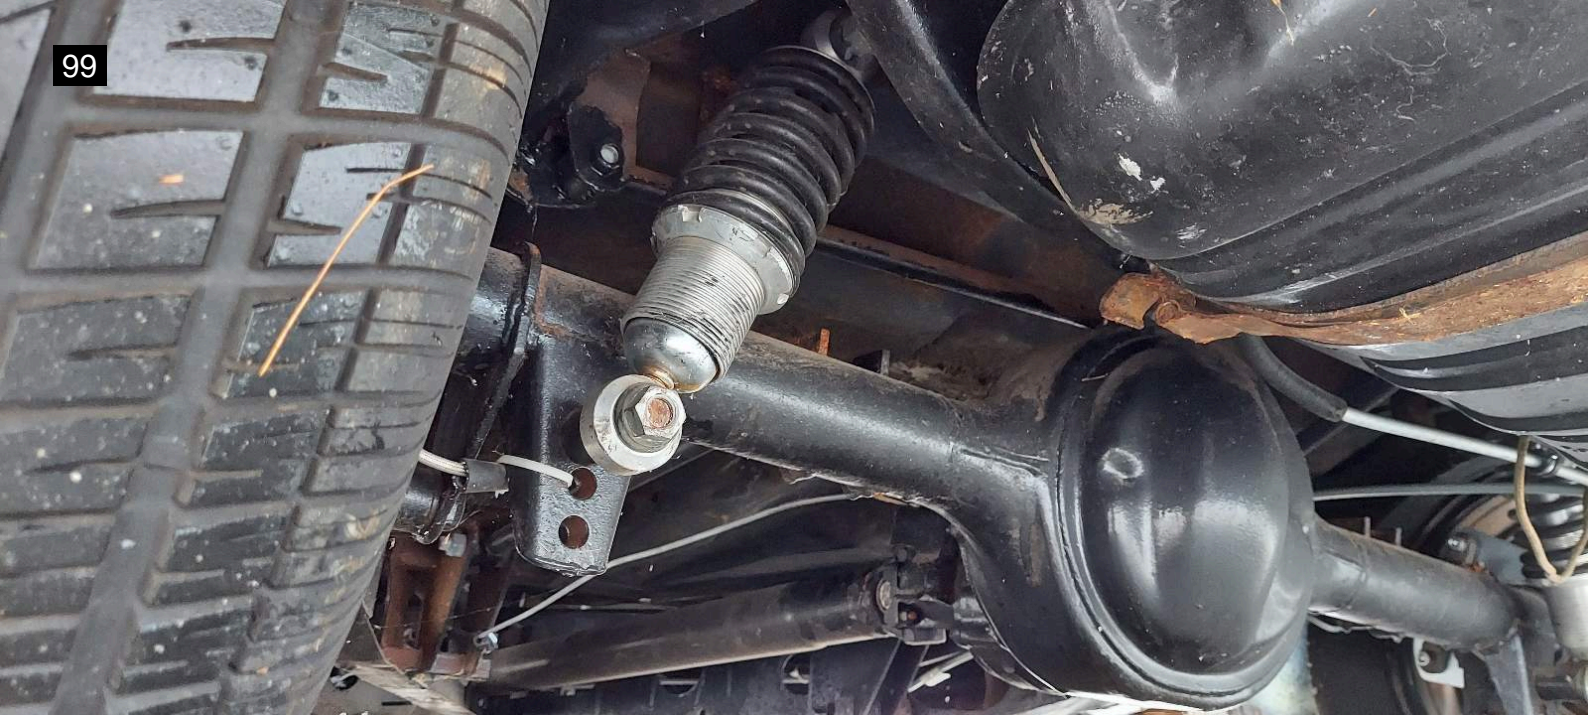

100





102


















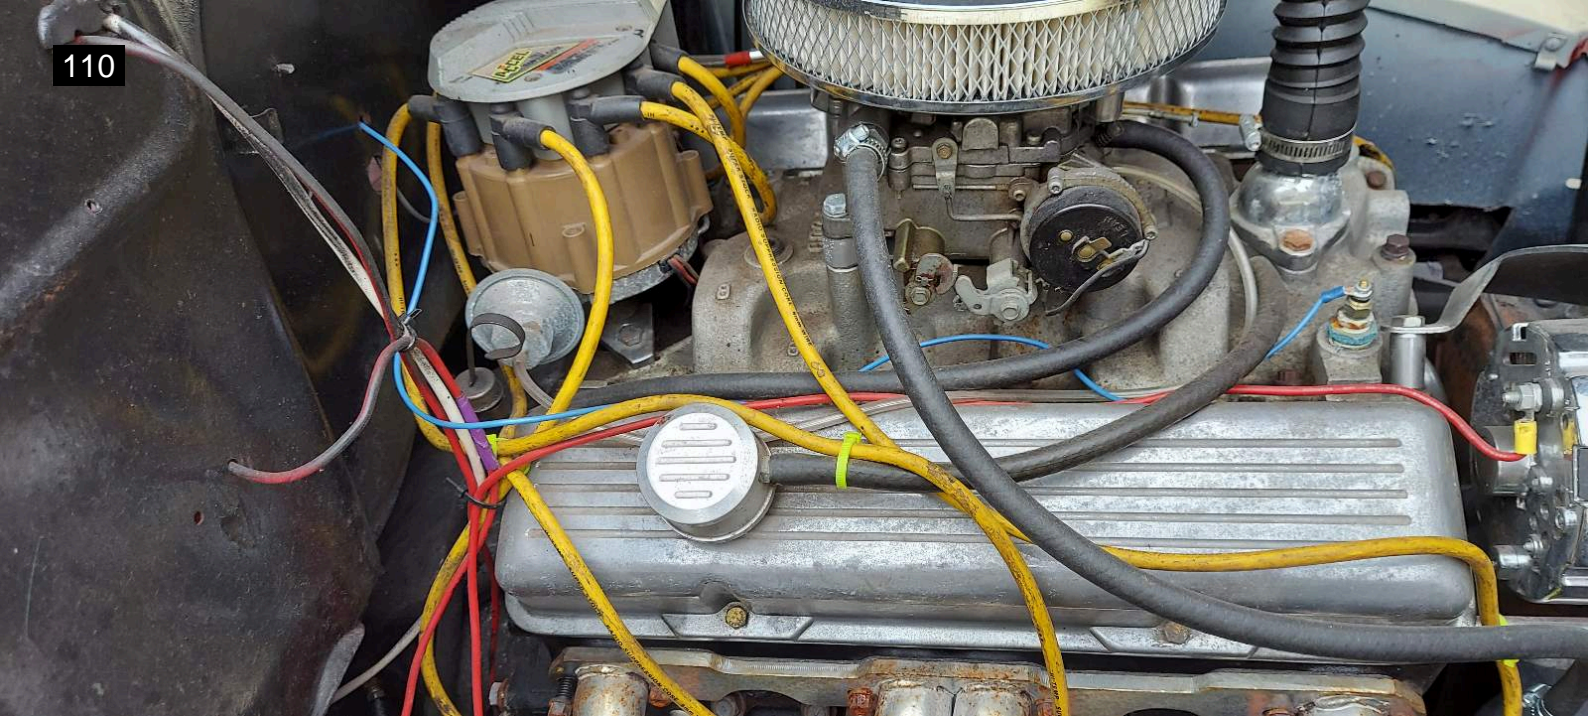

111

