REPORT #432154



1966 Sunbeam Tiger



This is a very unique vehicle and is in excellent shape and condition. Although not in show car condition it would be a fun car just as a driver. The engine and drive train are in very good condition. We were not able to perform a complete road test, per the seller. It was driven around a small parking lot and performed well. The only issue noted on the test drive is the hydraulic clutch slave and master cylinders may need rebuilding as the owner wasn't always able to completely disengage the clutch. The master was low and slightly corroded. The engine performed very smoothly and has good power as did the transmission other than some grinding from the clutch not always disengaging. I noted no abnormal rattles or vibrations during the parking lot test drive.

The body and chassis appear in very good condition I noted surface rust on some suspension components. Not all the door gaps were even and could use some adjustments. Noted a small amount of filler in the left quarter panel just behind the rear wheel and some in both rocker panel areas. Owner stated he had the rockers replaced when he had the car repainted about ten years ago. The hood has a functional mid 60's Thunderbird scoop mounted on it that helps with engine breathing and also cooling. The owner does have another original untouched factory hood that goes with the car. He also has several boxes of additional and spare parts, manuals, memorabilia and other items that also will be included in the sale.

The convertible top is in good condition but needs to be cleaned and allowed to breath as it has been stored in the well for a long period. The top boot and tonneau cover are also in good condition. The seats appear original with only a couple minor rips in the drivers seat. The owner stated he installed an electric fuel pump and electronic ignition for better starting and drivability.

Please see below for pictures and more info.

Vehicle Info		Mechanical	
Year - 1966		Air Filter	~
Make - Sunbeam		Battery Condition	~
Model - Tiger		Charging System	~
Mileage - 41016		Cooling Fan Condition	~
Transmission - Manual		Radiator Cap Sealing Properly	~
VIN Number - B38200083		Hoses	~
Stock Number - NA		Radiator	~
Interior - Vinyl		Engine Coolant	~
Interior Color - Black		Coolant Leaks	~
Body Color - White		Belts	~
Engine - 8 Cylinder		Engine Oil	~
Drive Type - Rear Wheel Drive		Engine Fluid Leaks	~
Fuel Type - Gas		Transmission Fluid	~
Engine Number - 4425-F21KA		Transmission Leaks	~
		Brake System	~
		Brake Fluid Leaks	~
Exterior			-
Wiper Blades	X	Differential leaks	~
The wipers are worn and should be replaced.	~	Muffler System	v
Body Alignment	×	CV Joints and Axles	 ✓
General misalignment to body panels, see pictures.		Shocks and bushings	~
Scratches	X	Ball Joints and Tie Rods	~
There are minor misc scratches around the vehicle. Most too sma	all to		
see in photos.		Road Test	
Dings	~		
Dents	~	Road Test	X
Paint Condition	~	Vehicle is not currently registered but it was driven in the parking	lot.
Body Seals	~	Engine Performance	
Rust	X	Engine Starting	~
The underside shows areas of minor surface rust. See pictures.	-	TIRES/WHEELS	
Exterior Lights	~	Spare Tire	~
Door Mirrors	~	Tire Manufacturer	
Bumpers	~	Driver's Front - Cornell	
Side Moldings	~	Passenger's Front - Cornell	
Convertible Top	X	Driver's Rear - Kenetica	
The convertible top shows wear and tear.			
Frame Damage	~	Passenger's Rear - Kenetica	
Glass	~	Tire Size	
Body Filler?	X	Driver's Front - 185/70R13	
Noted a small amount of filler in the left quarter panel just behind	the	Passenger's Front - 185/70R13	
rear wheel and some in both rocker panel areas. I checked the ve		Driver's Rear - 185/70R13	
with a magnet and found it to stick all around but was weaker in the	he	Passenger's Rear - 185/70R13	
lower panels. Not excessive.		Tire Condition	
Hood	~	Driver's Front - No Issues	
Doors	×	Passenger's Front - No Issues	
The door gaps could use some adjusting.		Driver's Rear - No Issues	
Floors	 <td>Passenger's Rear - No Issues</td><td></td>	Passenger's Rear - No Issues	
Rockers	×		
Seller stated the rockers were replaced about ten years ago. Quarter Panels	~	Wheel Condition	
		Driver's Front - No Issues	

Chrome

~

Interior

Steering Wheel	×
The wood steering wheel has a leather cover and a repla	acement horn
ring is in the back of the car.	
Horn	~
Seat Condition	×
There is light wear to the seats.	
Seat Belts	~
Clock	~
Inner Door Panels	~
Window Function	~
Center Console	~
Dash	~
Dash Lights	~
Dash Gauges	~
Heater	~
Carpet	~
Cigarette Use	~
Unusual Odors	~
Blower Motor	~
Interior Trim	~
Inner Trunk	~

Passenger's Front - No Issues	
Driver's Rear - No Issues	
Passenger's Rear - No Issues	
Tire Tread	
Driver's Front - 8/32	
Passenger's Front - 8/32	
Driver's Rear - 9/32	
Passenger's Rear - 9/32	
accongor o ritoar o/oe	
	10/32 OR MORE
	10/32 OR MORE Tires have plenty of
	Tires have plenty of tread!
	Tires have plenty of
	Tires have plenty of tread!
	Tires have plenty of tread! (standard)

(low profile) 5/32 TO 7/32 Tires will need replacement soon! 4/32 OR LESS Tires need replacement!

















































































































































































































































































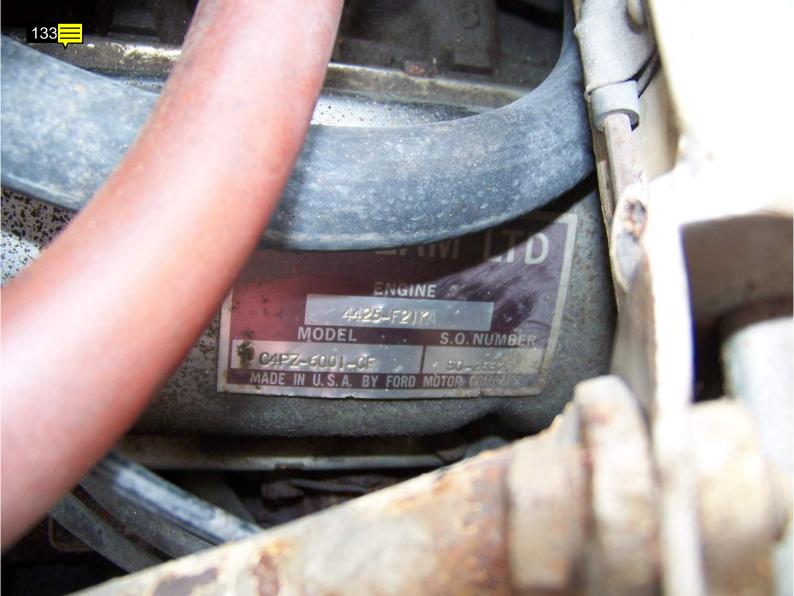







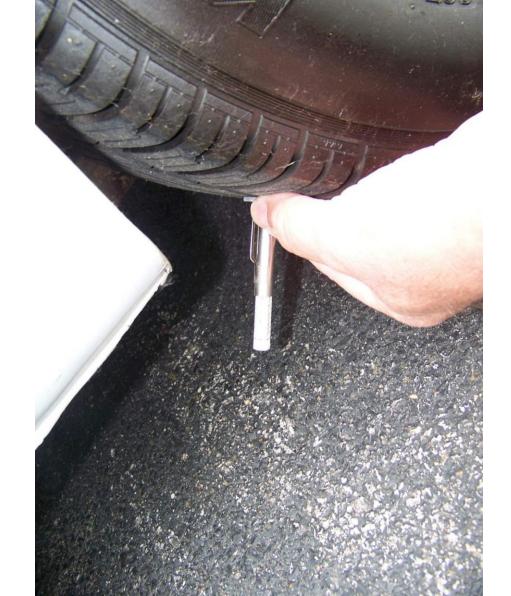




























































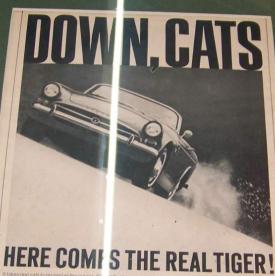

2011

It takes real cats to recognize the lop cat. Ro Tiger-a true British sports car with a wai lesser cars solk in their garages. Fast? W power plant it doesn't take off, it kaps

a Sunbeam placed first in its class in the 1965 Daytona 2000. It takes Inat makes a ford V-B PS. Look at the Tiger's lair-mate, the Sunbeam Alpine of SCAC Class F championi, proided asy to take \$2399.



















|--|

MV-639TR (1/15) NEW YORK	STATE REGISTRATION DOC		
E PAS		1.420.3	
DXK4505 1966 SUNBE	TRANSFERAL	AT.F	
CONV WH 002407 G 8	382000083 GW691766 MAY		
Wt/Seats Fuel/Cyl	CLK BTV041		
YACUZZO, RA		05/09/19	
43 LAKE ST	APT À	19.50	
LE ROY	NY 14482	ANNUAL CHG	
GW691766 VOID IN	ALTERED EXCEPT FOR ADDRESS	49.00	



Note for Image 19: Mileage

Note for Image 28: hole in LF seat

Note for Image 34: noted filler

Note for Image 42: hole in LF seat backrest

Note for Image 81: front undercarriage

Note for Image 82: front undercarriage

Note for Image 83: front undercarriage

Note for Image 84: LH side undercarriage

Note for Image 85: LH side undercarriage

Note for Image 86: LH side undercarriage

Note for Image 87: LH side undercarriage

Note for Image 88: noted filler

Note for Image 89: LH side undercarriage

Note for Image 90: rear undercarriage

Note for Image 91: rear undercarriage

Note for Image 92: rear undercarriage

Note for Image 93:

rear undercarriage

Note for Image 97: fuel filler

Note for Image 130: spare hood

Note for Image 131: spare hood

Note for Image 133: engine label

Note for Image 134: LF tire

Note for Image 135: LF tire

Note for Image 136: LR tire

Note for Image 137: LR tire

Note for Image 138: RR tire

Note for Image 139: RR tire

Note for Image 140: RF tire

Note for Image 141: RF tire

Note for Image 172: current registration