

Report #464962

## 1967 Chevrolet Camaro Convertible



## Summary

1967 Chevrolet Camaro convertible. Seller disclosed that it has super sport badges and wheels but it may not be a true super sport. In 1967 you could order SS and RS parts making it an RS/SS. After my inspection this is what I determine it to be. The tail lights have been upgraded to LED's.

This classic vehicle looks to have been well kept with minor issues of note. I found no obvious signs of the vehicle having prior major accident or flood damage. There are minor misc. scratches around the vehicle. Normal for mileage and most too small to see in photos. The underside shows areas of minor surface rust. See pictures. The vacuum operated headlight covers do not move and should be repaired. The convertible top shows wear and some wrinkles. The exterior shows very little wear with what is considered to be appropriate for the mileage of the vehicle.

The interior shows very well with only light wear noted, and there are some mild alterations. The horn does not work. There is light wear to the seats. Normal for mileage. The inner door panels show light wear consistent with mileage. The carpet shows normal wear consistent with mileage. All accessories are working as designed.

I found no issues on the test drive. The engine had plenty of power and there were no misfires. The transmission shifted as designed with no harsh engagement or slipping. The steering was responsive and the suspension was firm and the vehicle handled well. There were no abnormal vibrations or odd noises. The brakes were firm with no pulsation felt. There were no leaks found to the underside of the vehicle. See below and pictures for more info.

### Inspection Info

Please take 100+ photos and a walk around video. Note that these photos will be used in an on-line auction so please be sure to include (in addition to the usual inspection photos) photos that show the entire car - ¾ views of the front, rear and side photos along with photos that show the full engine and photos of the interior and underneath. Please be sure to have pleasing back grounds that do not include additional people. For the walk around video, please no talking and take in a landscape view (no portrait) with the engine running. Keep in mind when inspecting and writing up that this vehicle is an antique. Also please reach out to the owner of the vehicle prior to the inspection to confirm date/time/location, etc. Thanks!










### Vehicle Information

Year	1967
Make	Chevrolet
Model	Camaro Convertible
VIN	124677n123008
Stock No.	123008
Mileage	46794
Engine Cylinders	8 Cylinder
Exterior Color	Yellow
Interior Color	Black
Interior Material	Vinyl
Engine Number	N/A
Transmission Number	N/A
Fuel Type	Gas








### Drivetrain

Transmission	Automatic
Drive Type	Rear Wheel Drive



















### Road Test

Road Test	 Good
Engine Starting Easily	 Good
Engine running well after Started	 Good
Transmission performance	 Good
Differential Performance	 Good
Wheel Bearing Performance	 Good
Braking Performance	 Good
Suspension Performance	 Good
Steering Performance and Alignment	 Good

## Exterior























Wiper Blades	 Good
Body Panel Alignment	 Good
Scratches	 Issues
There are minor misc scratches around the vehicle. Normal for mileage and most too small to see in photos.	
Paint Condition	 Good
Seals	 Good
Rust	 Issues
The underside shows areas of minor surface rust. See pictures.	
Exterior Lights	 Issues
The vacuum operated headlight covers do not move and should be repaired.	
Power Door Mirrors	 Good
Bumpers	 Good
Side Moldings	 Good
Convertible Top	 Issues
The convertible top shows wear and some wrinkles.	
Underbody/Frame Condition	 Good
Glass	 Good
Floors	 Good
Rockers	 Good
Quarter Panels	 Good
Hood	 Good
Doors	 Good
Dings	 Good
Dents	 Good
Chrome	 Good

## Interior

Steering Wheel	 Good
Horn	 Issues
The horn does not work.	
Seat Condition	 Issues
There is light wear to the seats. Normal for mileage.	
Seat Belts	 Good
Inner Door Panels	 Issues
The inner door panels show light wear consistent with mileage.	
Dash	 Good
Dash Lights Working	 Good
Air Conditioning	 Good
Heater	 Good
Carpet	 Issues
The carpet shows normal wear consistent with age and mileage.	
Signs of Smoking?	 Good
Cup Holders	 Good
Headliner	 Good
Instrument Cluster/Gauges	 Good
Unusual Odors	 Good
Window Function	 Good
Interior Trim	 Good
Sun Visors	 Good



## Mechanical

Air Filter	 Good
Battery Condition	 Good
Charging System	 Good
Cooling Fan Condition Mechanical/Electronic	 Good
Hoses and Clamps Age/Cracking	 Good
Radiator Condition	 Good
Engine Coolant Condition	 Good
Belts	 Good
Power Steering System	 Good
Power Steering Fluid Condition	 Good
Engine Oil Condition	 Good
Engine Oil Leaks	 Good
Transmission Fluid Condition	 Good
Transmission Fluid Leaks	 Good
Brake System Condition	 Good
Brake Fluid Leaks	 Good
Differential leaks	 Good
Muffler System	 Good
Shocks and bushings Condition. Leaking?	 Good
Ball Joints and Tie Rods	 Good
Radiator Cap Sealing Properly	 Good
Coolant Leaks	 Good

## Tire / Wheels

Manufacturer	
Driver's Front Tire	BFGoodrich
Passenger's Front Tire	BFGoodrich
Driver's 1st Axle Outer Tire	BFGoodrich
Passenger's 1st Axle Outer Tire	BFGoodrich
Size	
Driver's Front Tire	215/60r14
Passenger's Front Tire	215/60r14
Driver's 1st Axle Outer Tire	235/60r14
Passenger's 1st Axle Outer Tire	215/60r14
Tire Condition	
Driver's Front Tire	No Issues
Passenger's Front Tire	No Issues
Driver's 1st Axle Outer Tire	No Issues
Passenger's 1st Axle Outer Tire	No Issues
Wheel Condition	
Driver's Front Tire	Missing Hubcap/Center Cap
Driver's 1st Axle Outer Tire	No Issues
Passenger's Front Tire	No Issues
Passenger's 1st Axle Outer Tire	No Issues
Tire Tread	
Driver's Front Tire	7/32
Passenger's Front Tire	6/32
Driver's 1st Axle Outer Tire	8/32
Passenger's 1st Axle Outer Tire	8/32
Spare Tire	
Yes	

## Vehicle Images



























































































Vehicle Services Bureau

P.O. Box 201431, 302 N Roberts, Helena, MT 59620-1431

Phone (406) 444-3661

Fax (406) 444-0116

mtvtitleinfo@mt.gov

## Statement of Fact

MTV 100  
COPY

The Statement of Fact (form MV100) may be used for the purpose of a:

- No interest statement
- Cancellation of sale statement
- Letter of consent
- Relinquishment statement
- Statement of error
- No security interest or lien to file statement
- Request to update customer record residential/mailling address
- Special mailing authorization (titles will be mailed to out-of-state addresses only)
- Legal signature statement
- Letter of explanation
- One and the same statement\*

Printed name of person making statement and name of firm or corporation Sandra K. Petley  
Powell County Museum and Arts Foundation

Year 1967 Make Chevrolet Title Number AA4778687

Vehicle/Vessel Identification No: 124677N123008

Statement I wrote the name of our foundation  
on the line that the Buyer's Address  
should have been placed. The address should be  
6081 MS Hwy 415  
ACKERMAN, MS 39735

\* Indicate how name is to be entered on the Title:

Under penalty of law (MCA 45-7-203), I certify that the statements made and information contained on this form are true and correct to the best of my knowledge, information, and belief; I am the person named on this form; and, if signing for a business entity or trust, I have full authority to do so.

Signature Sandra K. Petley Date 6/25/20

Printed name Sandra K. Petley Director - Agent

Email Address directorskp@pcmaf.org Phone Number 406-846-3111


Montana county and state authorities reserve the right to reject any form that has been altered.  
This form is available in alternate formats for people with disabilities.

MV100 (1/18)







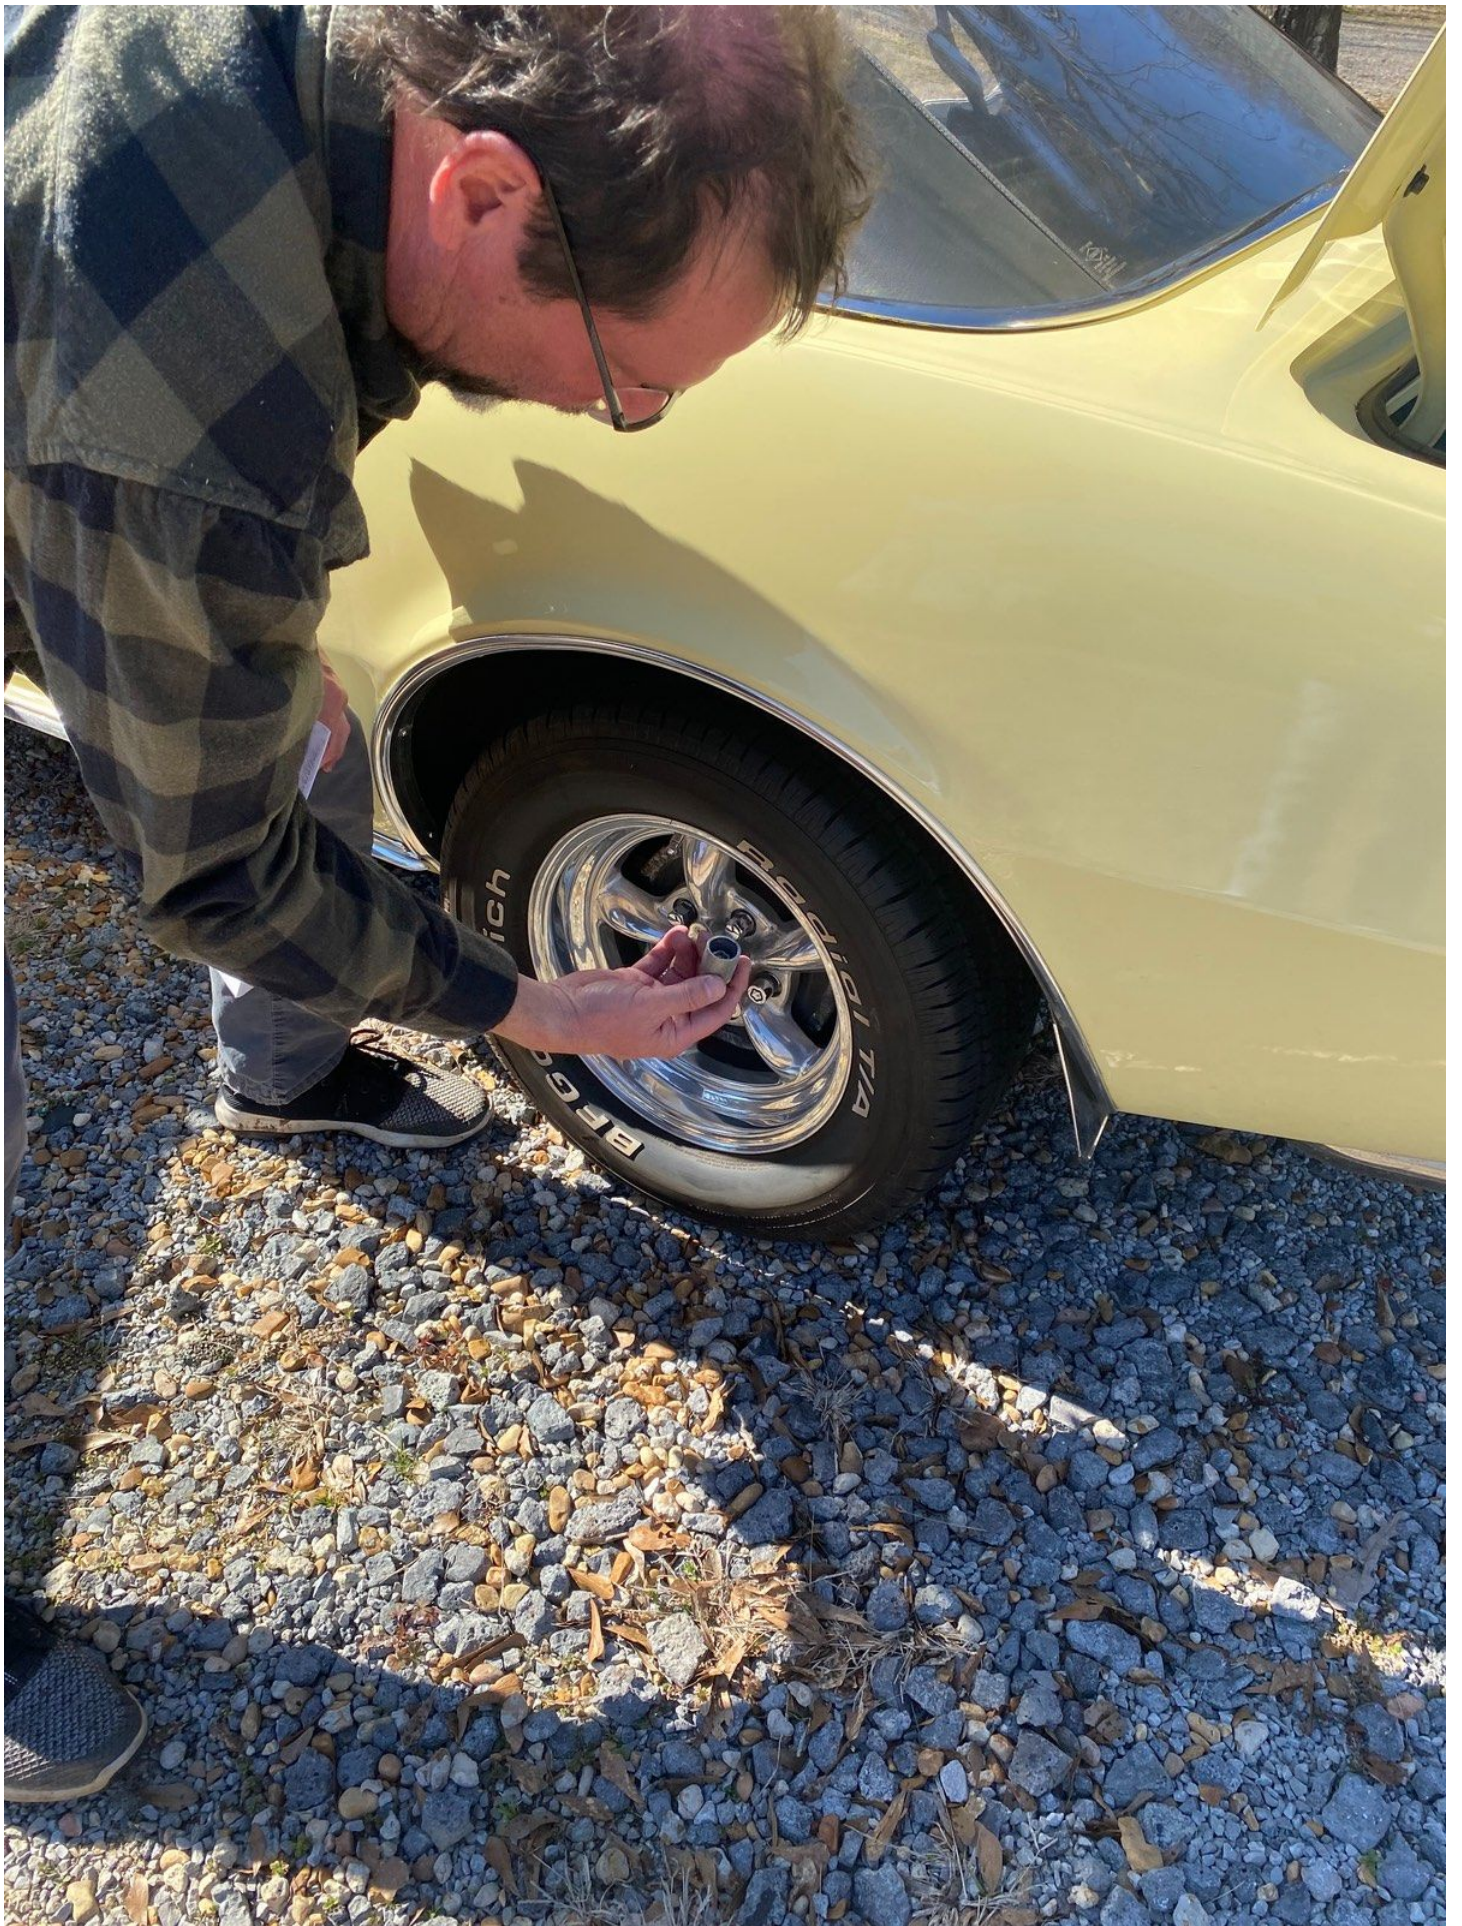





## SPARE WHEEL CARRIER LOCK INSTRUCTION SHEET



- STEP 1** (PASS "F" SERIES) INSTALL BOLT IN BRACKET.  
**STEP 2** ALIGN JACK BASE SO ANY WHEEL STUD HOLE IS CENTERED WITH REAR EDGE OF BASE.  
**STEP 3** ALIGN & TIGHTEN WING NUT WITH WINGS PARALLEL TO REAR EDGE OF JACK BASE.  
**STEP 4** THREAD SPECIAL NUT (CHAMFERED EDGE DOWN) ON PROTRUDING STUD & ALIGN FLATS PARALLEL TO JACK BASE SIDES. USE LONGER NUT ON WAGON & PICKUP.  
**STEP 5** INSERT RETAINER END INTO WHEEL STUD HOLE & LOOPED END OVER SPECIAL NUT.  
**STEP 6** PUSH LOCK OVER SPECIAL NUT UNTIL IT FASTENS. **NOTE** Chevelle Wagon-lock arm must be installed with the key slot in lower position in order to insert key.  
**STEP 7** TO ELIMINATE RATTLES TURN WING NUT UNTIL THE WINGS BIND AGAINST LOCK.  
**NOTE** Use looped end of retainer for a wrench to tighten or loosen special nut.

© General Motors Corporation 1966

4-18-66 PART NO. 3903456

PRINTED IN U.S.A.





























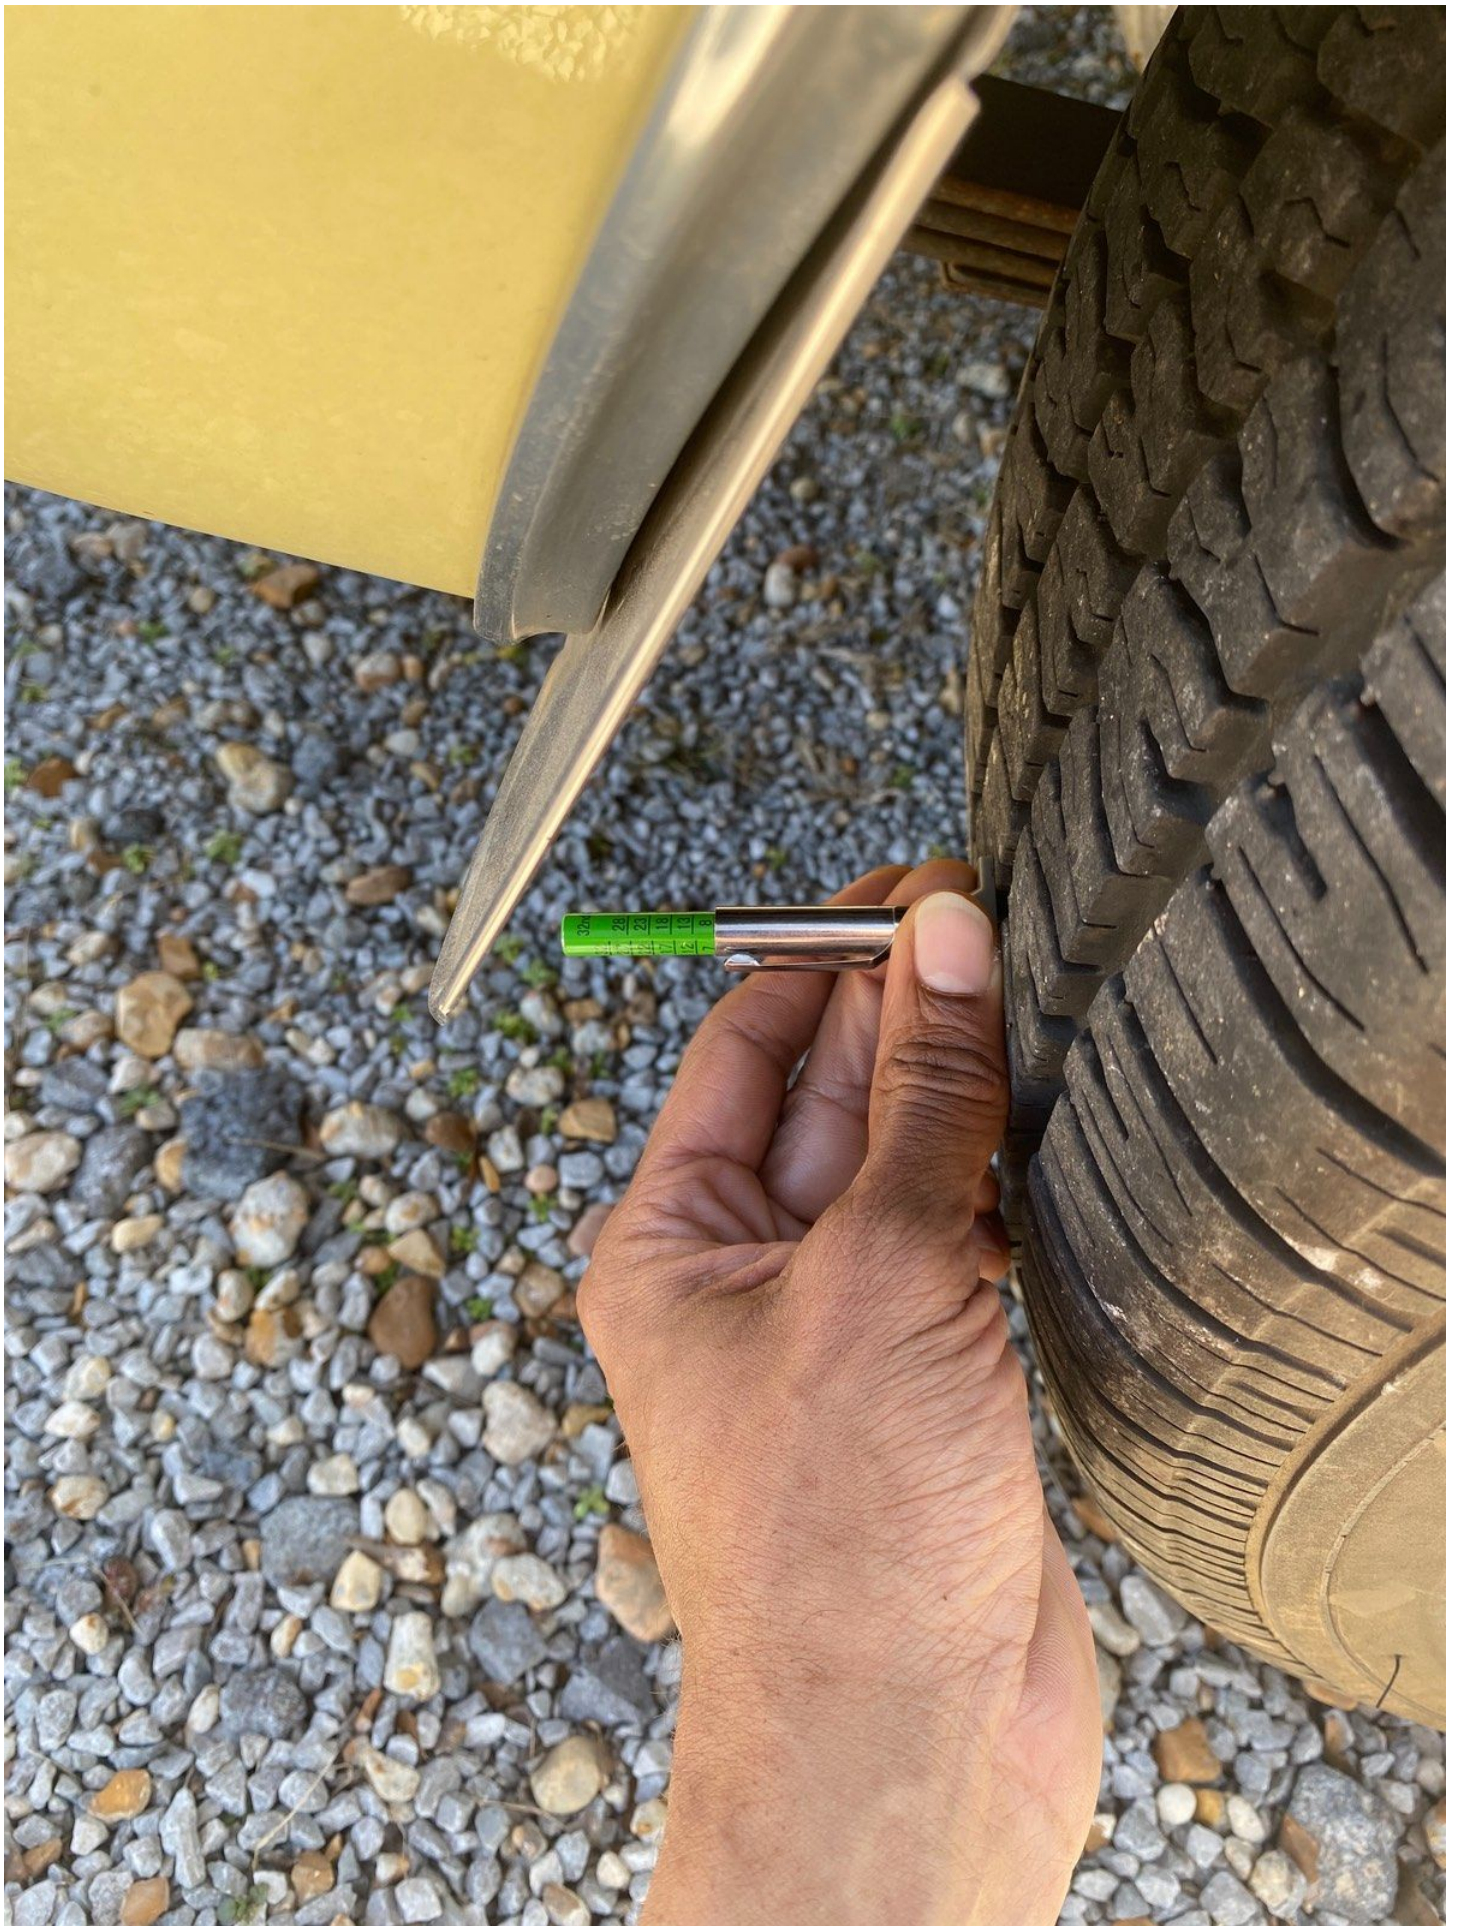







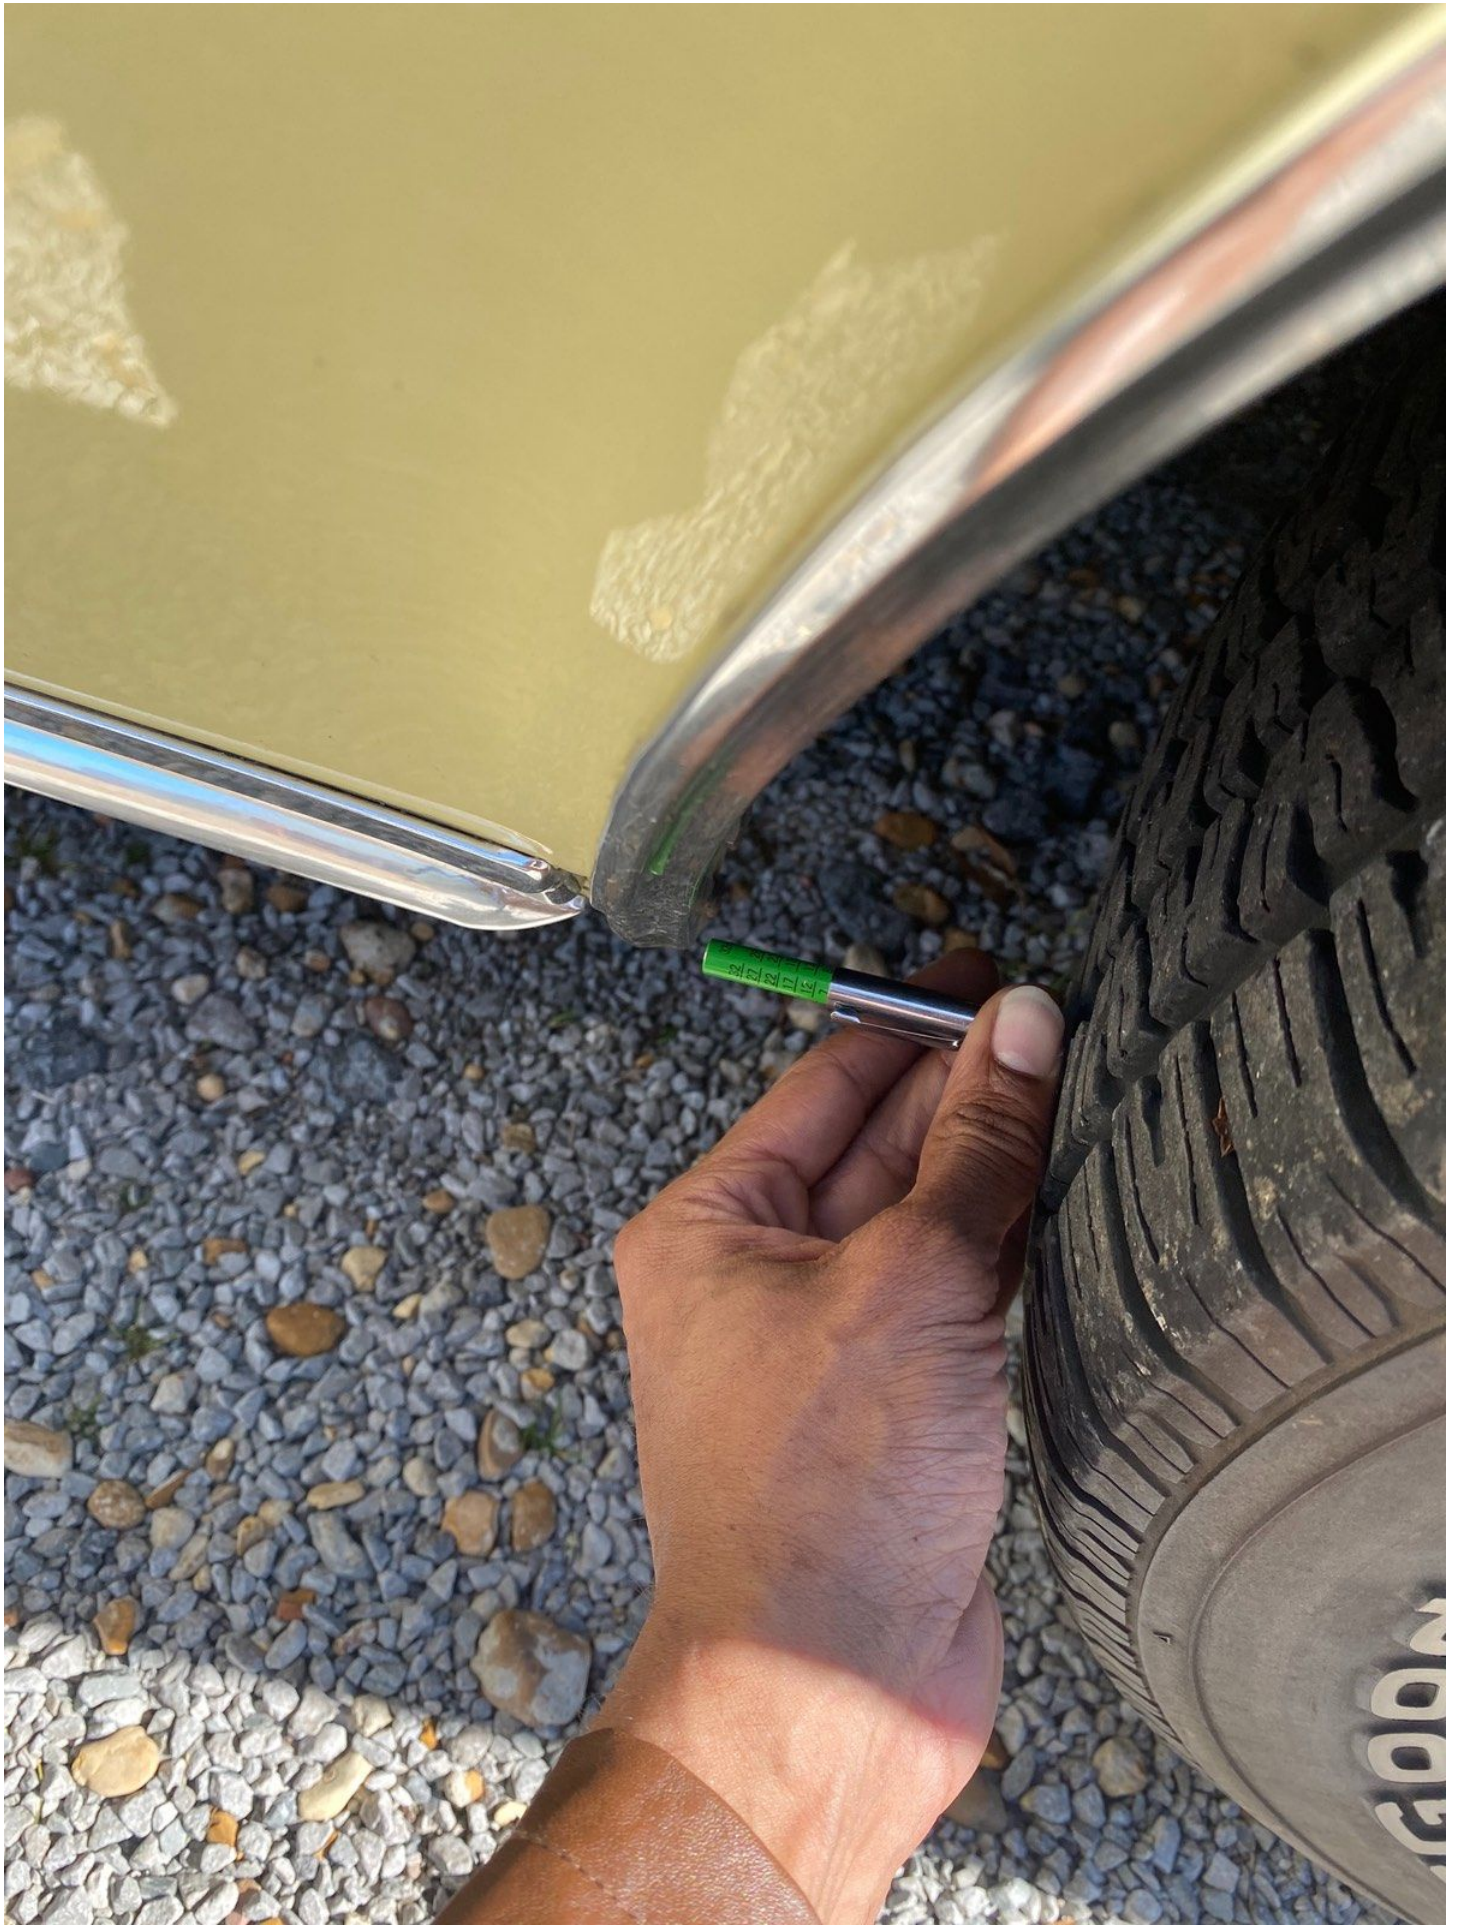







## 1967 1st Generation Chevrolet Camaro SS Convertible

- Gorgeous Butternut Yellow exterior
- New black convertible top with black boot
- RS grill with hide-a-way headlights
- New door panels, seat covers black with white piping
- AM radio, new Auto gauge cluster added below the dash
- 350 V-8 engine
- Chrome valve covers and air cleaner
- 350 automatic transmission
- Floor console and shifter
- Power steering
- Power brakes
- New chrome bumpers and mirrors
- New dual exhaust from the manifolds back
- New fuel tank
- New shocks front and back
- Still has all 4 cocktail shakers

Zip: \_\_\_\_\_

mation letter)

Security Code: \_\_\_\_\_

Pin #: \_\_\_\_\_


ion Call (406) 846-3111

which includes the Montana Auto  
owell County Museum. Old Prison  
slice of Montana and Automotive

n-profit 501(c)3 organization. All  
T at The Pen Convention Center.  
be received by 4 p.m., December  
ited by law. Winner will be notified  
ges.

the proud owners of the 1967 1st



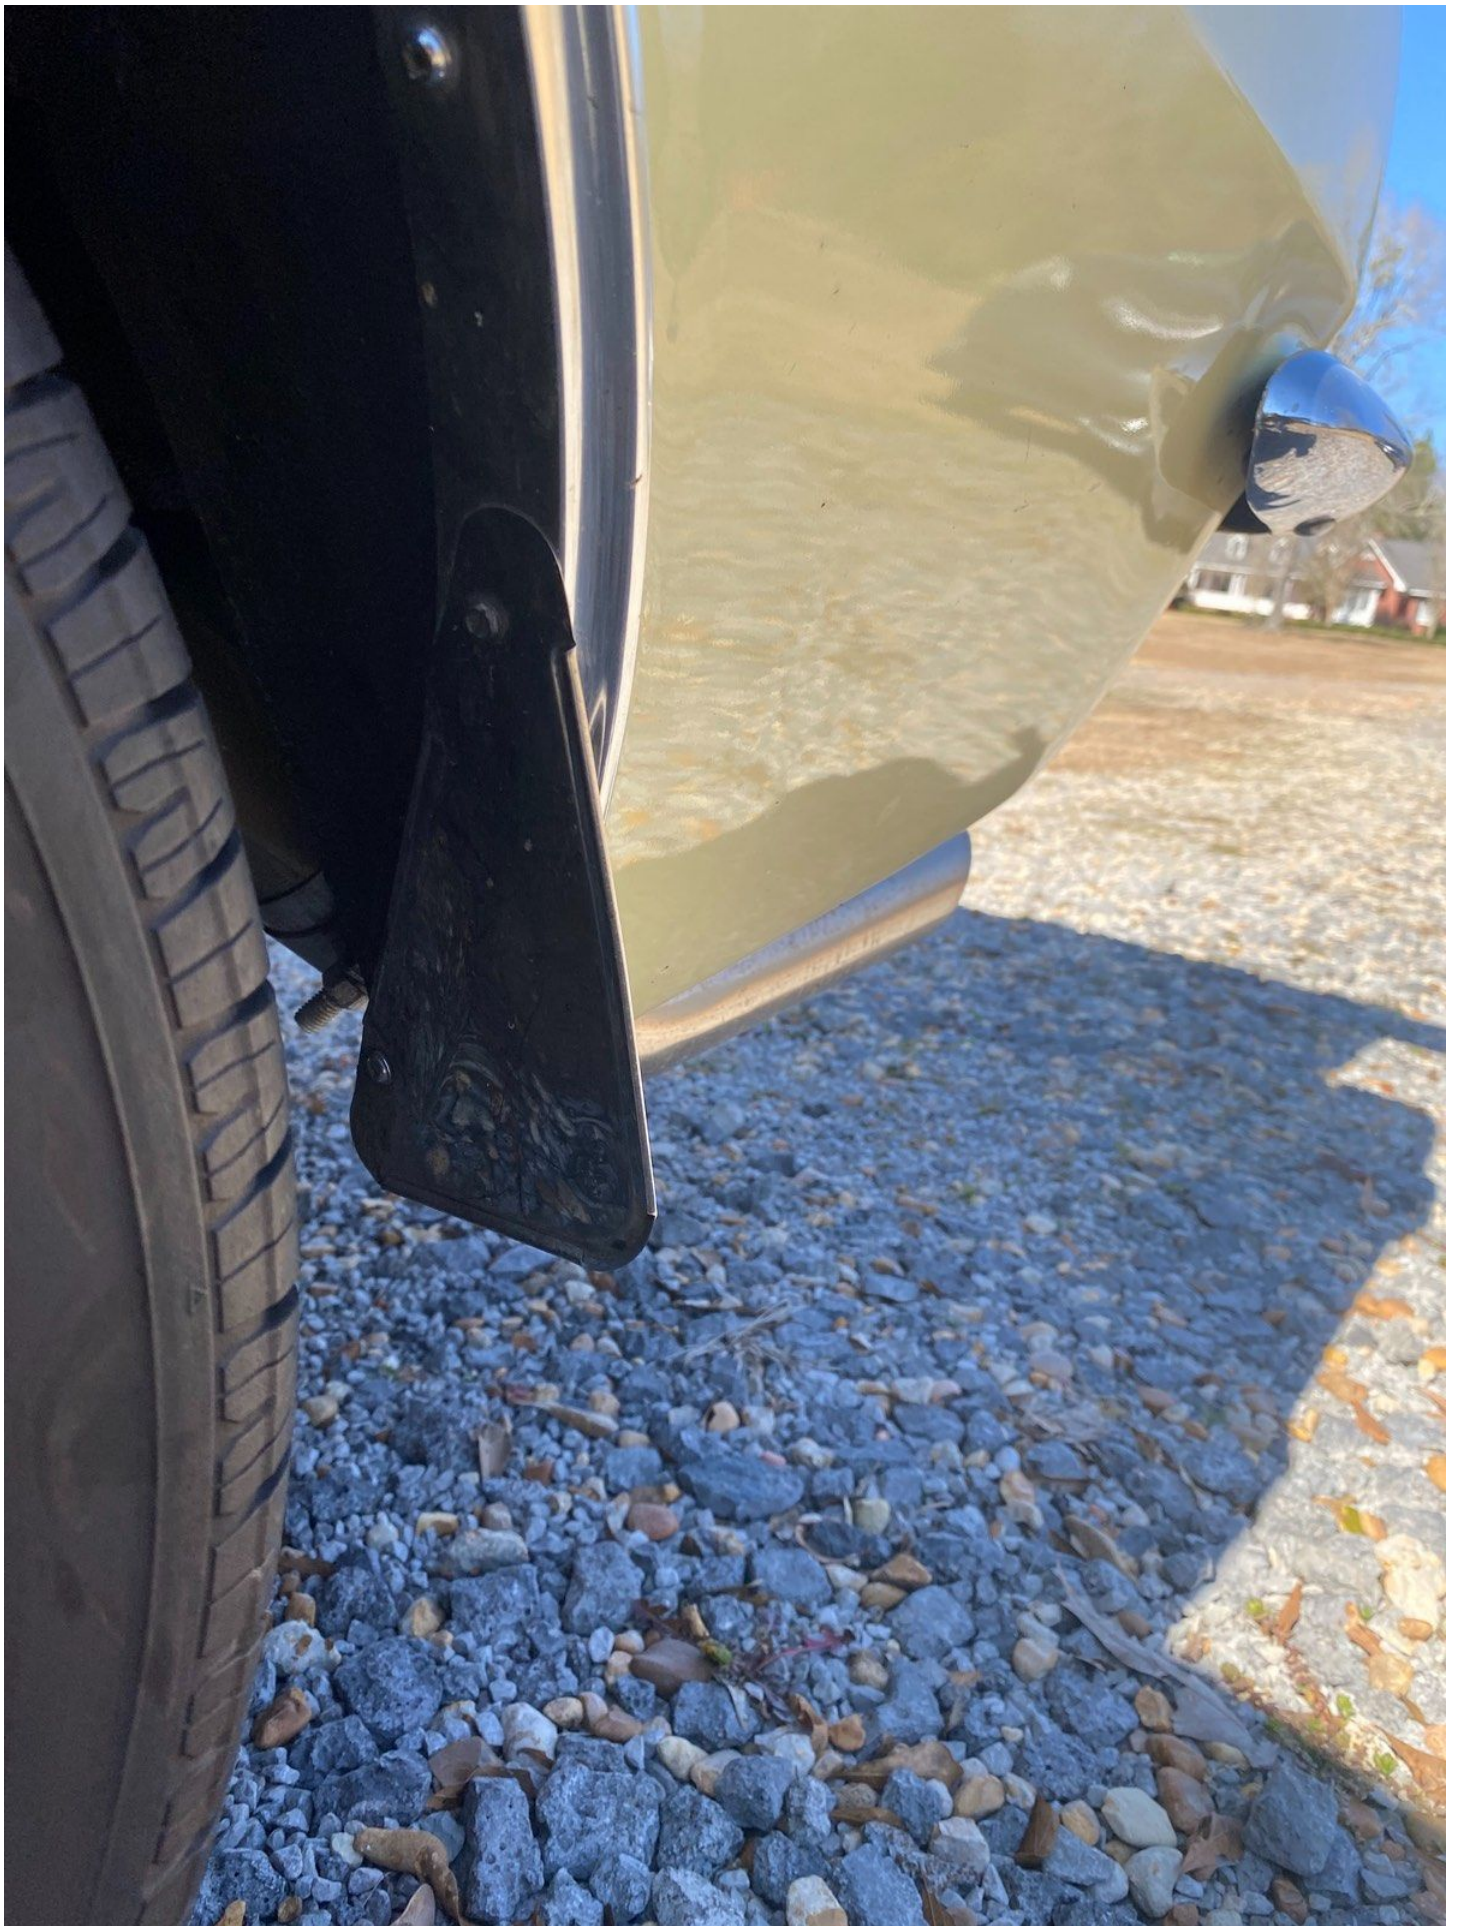



camaro

350


































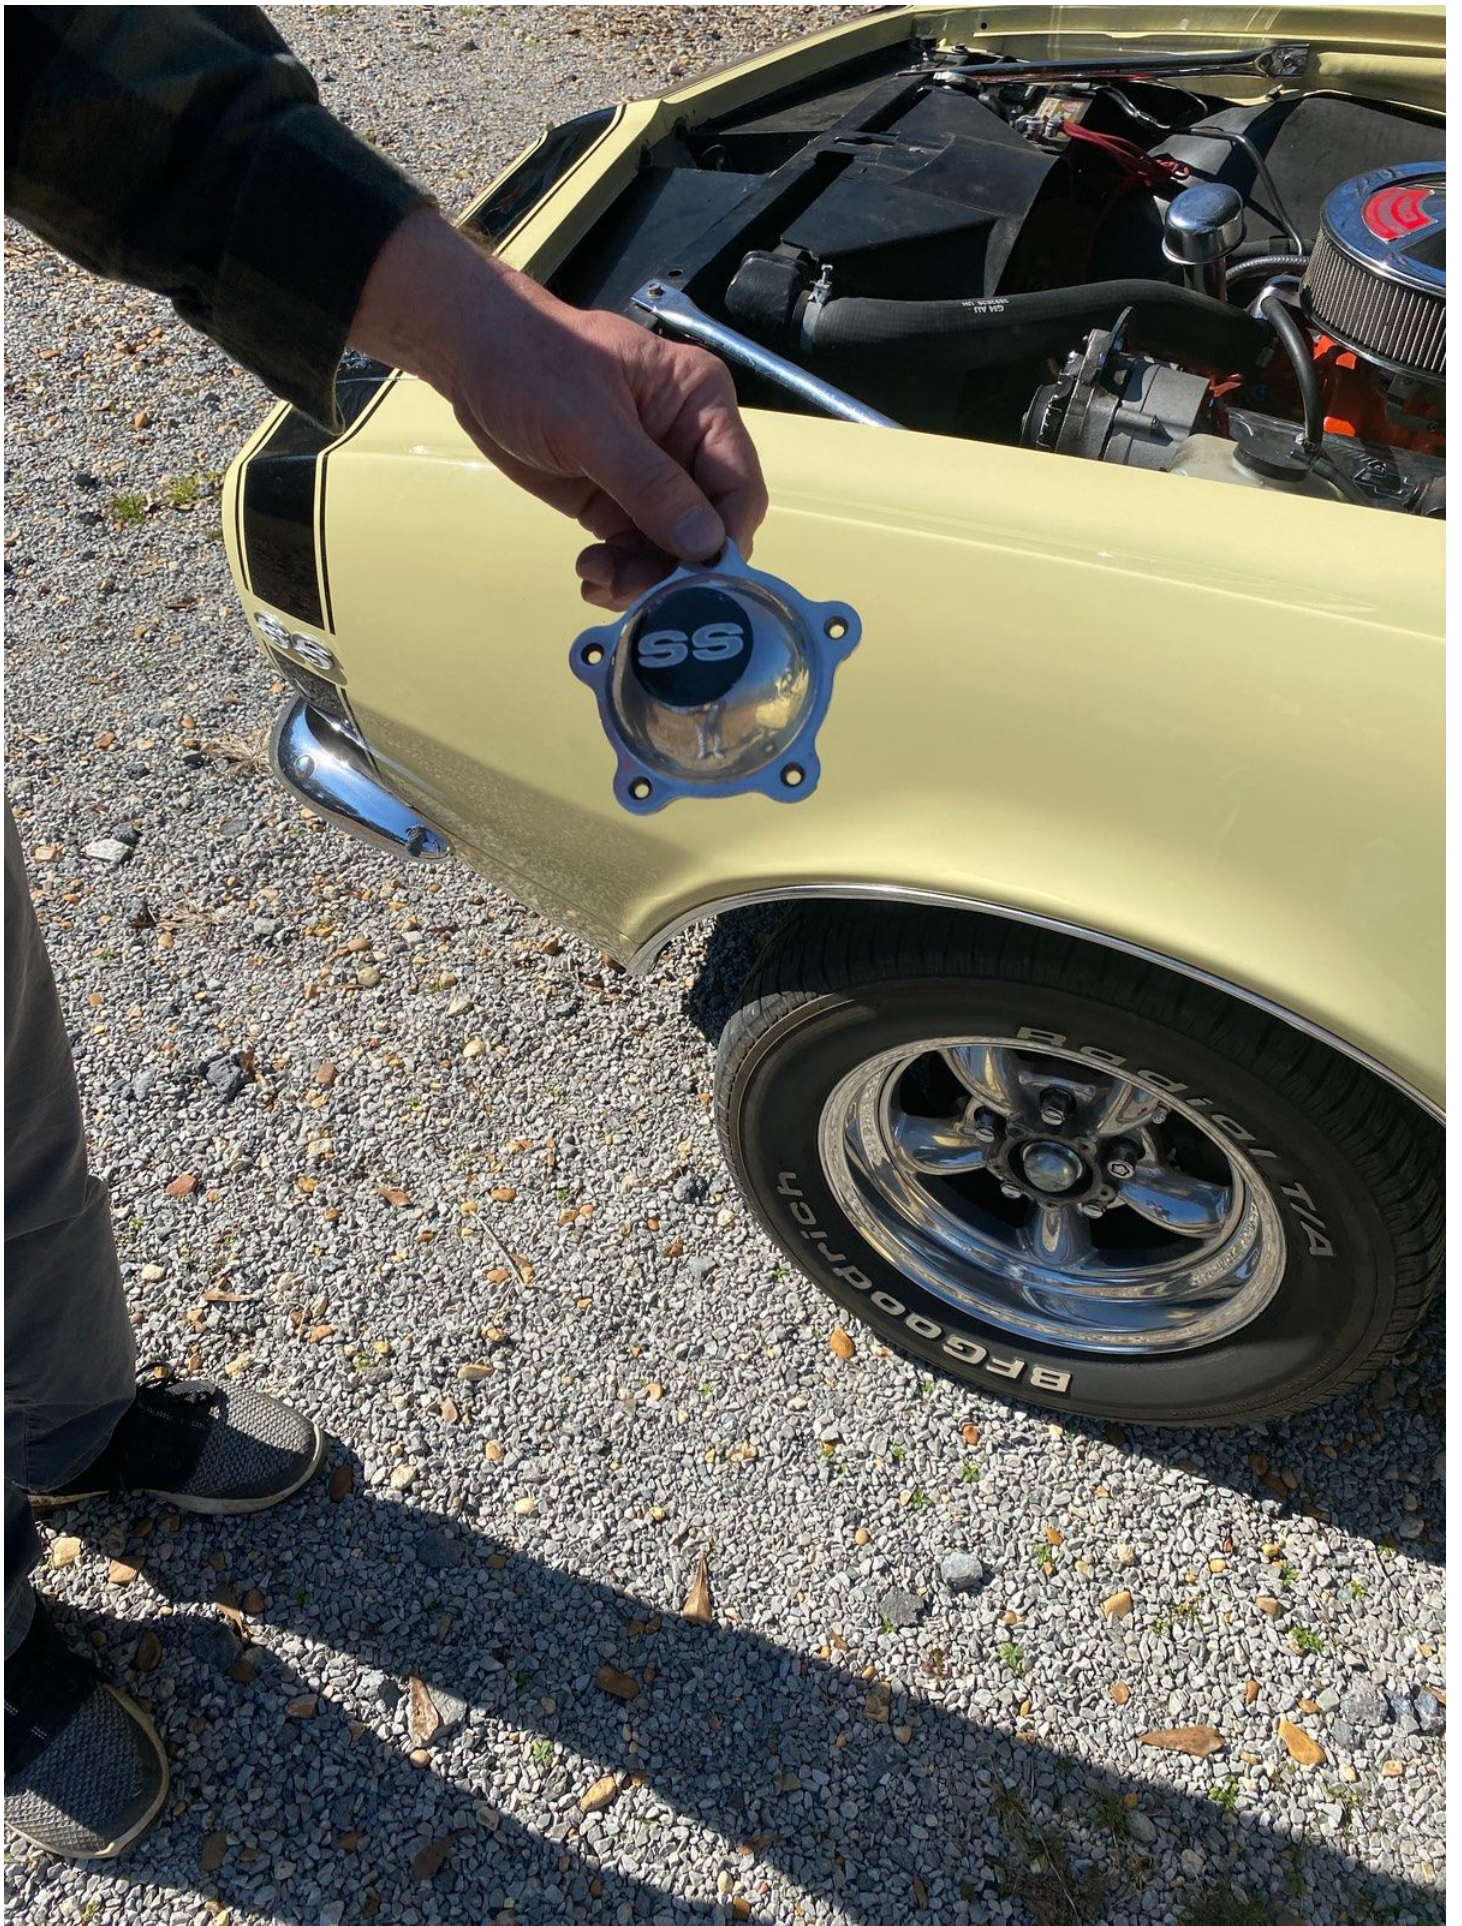











































4:24



Today  
1:35 PM

Edit

# DEPARTMENT OF JUSTICE - MOTOR VEHICLE DIVISION CERTIFICATE OF TITLE

cja536

Title Nbr <b>AA4778687</b>	Year <b>1967</b>	Make <b>Chevrolet</b>	Model <b>Camaro</b>	Extended Model	Style <b>CV</b>	NCIC Vehicle Type <b>PC</b>	Unladen Weight/Material <b>3180</b>
VIN/HIN <b>124677N123008</b>	MT Boat Nbr	Ton Code/Propulsion Type		Odometer	Vehicle Nbr <b>4663340</b>		
Brand	Title Issue Date <b>12/26/2019</b>	Vehicle Sale Date <b>12/10/2019</b>	Transfer Reason <b>OOS Title Transfer</b>	Attribute	Owner Tracking Nbr	Fleet Nbr	

Owner Name and Address  
Powell County Museum And Arts  
Foundation  
1106 Main St  
Deer Lodge MT 59722-1426  
Customer Number: 1509952

This vehicle/vessel is subject to the following security interest(s):

Mail To:

**Powell County Museum And Arts Foundation  
1106 Main St  
Deer Lodge MT 59722-1426**

The vehicle/vessel may be subject to other security interests.

As the Registered Owner of the above vehicle, I transfer all right, title and interest to the vehicle to the following person, as of the date below:

Print name of buyer, whether individual or business: **HAL PAURELL OR RENAE AURELL** Date of Transfer (delivery of vehicle) **6/3/20**

Buyer's Street Address: **Powell County Museum And Arts Foundation** City: **Deer Lodge** State: **MT** Zip: **59722**

Federal and state law require that the owner state the mileage of a vehicle upon transfer of ownership. If you fail to complete this disclosure or provide a false statement, you may be subject to fines and/or imprisonment.

I state that this (check one) ☒ 5 or 6 ☐ digit odometer now reads (no tenths) **43382** miles, date read **5/12/20** and to the best of my knowledge it reflects the actual mileage unless one of the following statements is checked.

DO NOT CHECK UNLESS APPLICABLE: ☐ The odometer reading reflects the amount of mileage in excess of its mechanical limits. ☐ The odometer reading is not the actual mileage. Warning - odometer discrepancy.

ALL OWNERS MUST SIGN - Additional owners are listed to the right of the first owner above.

Under penalty of law, I certify the above odometer disclosure and transfer of ownership information is correct to the best of my knowledge; that I am the same person named above, and if signing for a business entity or trust, I have full authority to act upon behalf of the owner, whose name appears on the upper left side of this Title.

ALL OWNERS MUST SIGN: Signature of First Owner or Agent of Owner (For owner): **[Signature]** Printed name - must be the same as signature (do not type) **SHARON K. POTTER**

Signature of Additional Owner or Agent of Owner (if more than one): **[Signature]** Printed name - must be the same as signature (do not type) **SHARON K. POTTER Director Agent**

Notice: notarization is only required for private sales from an individual to an individual. Vehicles sold to licensed dealerships are not required to be notarized.

State of **MT** County of **Powell** Signed before me on (date) Notary Stamp/Seal



By (Clearly print name of person requesting notary service)

Sandra K. Petty

Notary signature

Kia Jean Carlin

ACKNOWLEDGEMENT OF MILEAGE DISCLOSURE: I am aware of the above odometer certification made by the seller.

Signature of Buyer (only one signature is required)

H.P. Aunell

Printed name - must be the same as signature (do not type)

HAL Pierce Aunell



KIA JEAN CARLIN  
Notary Public for the  
State of Montana  
Residing at DEER LODGE, MT  
My Commission Expires  
June 6, 2023



VEHICLE SERVICES BUREAU  
P.O. BOX 201431  
HELENA MT 59620-1431



CONTROL NO. 15927787  
(This is not a title number)

(REV. 11/2017)

KEEP IN A SAFE PLACE. ANY ALTERATION, USE OF CORRECTION FLUID OR ERASER VOID THIS CERTIFICATE.







Vehicle Services Bureau

P.O. Box 201431, 302 N Roberts, Helena, MT 59620-1431

Phone (406) 444-3661

Fax (406) 444-0116

• mvdtitleinfo@mt.gov

## Statement of Fact

MTV 100  
COPY

The Statement of Fact (form MV100) may be used for the purpose of a:

- No interest statement
- Cancellation of sale statement
- Letter of consent
- Relinquishment statement
- Statement of error
- No security interest or lien to file statement
- Request to update customer record residential/mailling address
- Special mailing authorization (titles will be mailed to out-of-state addresses only)
- Legal signature statement
- Letter of explanation
- One and the same statement\*

Printed name of person making statement and name of firm or corporation Sandra K. Petley  
Powell County Museum and Arts Foundation

Year 1967 Make Chevrolet Title Number AA4778687

Vehicle/Vessel Identification No: 124677N123008

Statement I wrote the name of our foundation  
on the line that the Buyer's Address  
should have been placed. The address should be  
6081 MS Hwy 415  
ACKERMAN, MS 39735

\* Indicate how name is to be entered on the Title:

Under penalty of law (MCA 45-7-203), I certify that the statements made and information contained on this form are true and correct to the best of my knowledge, information, and belief; I am the person named on this form; and, if signing for a business entity or trust, I have full authority to do so.

Signature Sandra K. Petley Date 6/25/20

Printed name Sandra K. Petley Director - Agent

Email Address directorskp@pcmaf.org Phone Number 406-846-3111

Montana county and state authorities reserve the right to reject any form that has been altered.  
This form is available in alternate formats for people with disabilities.

MV100 (1/18)



6:28




Today  
1:35 PM

Edit





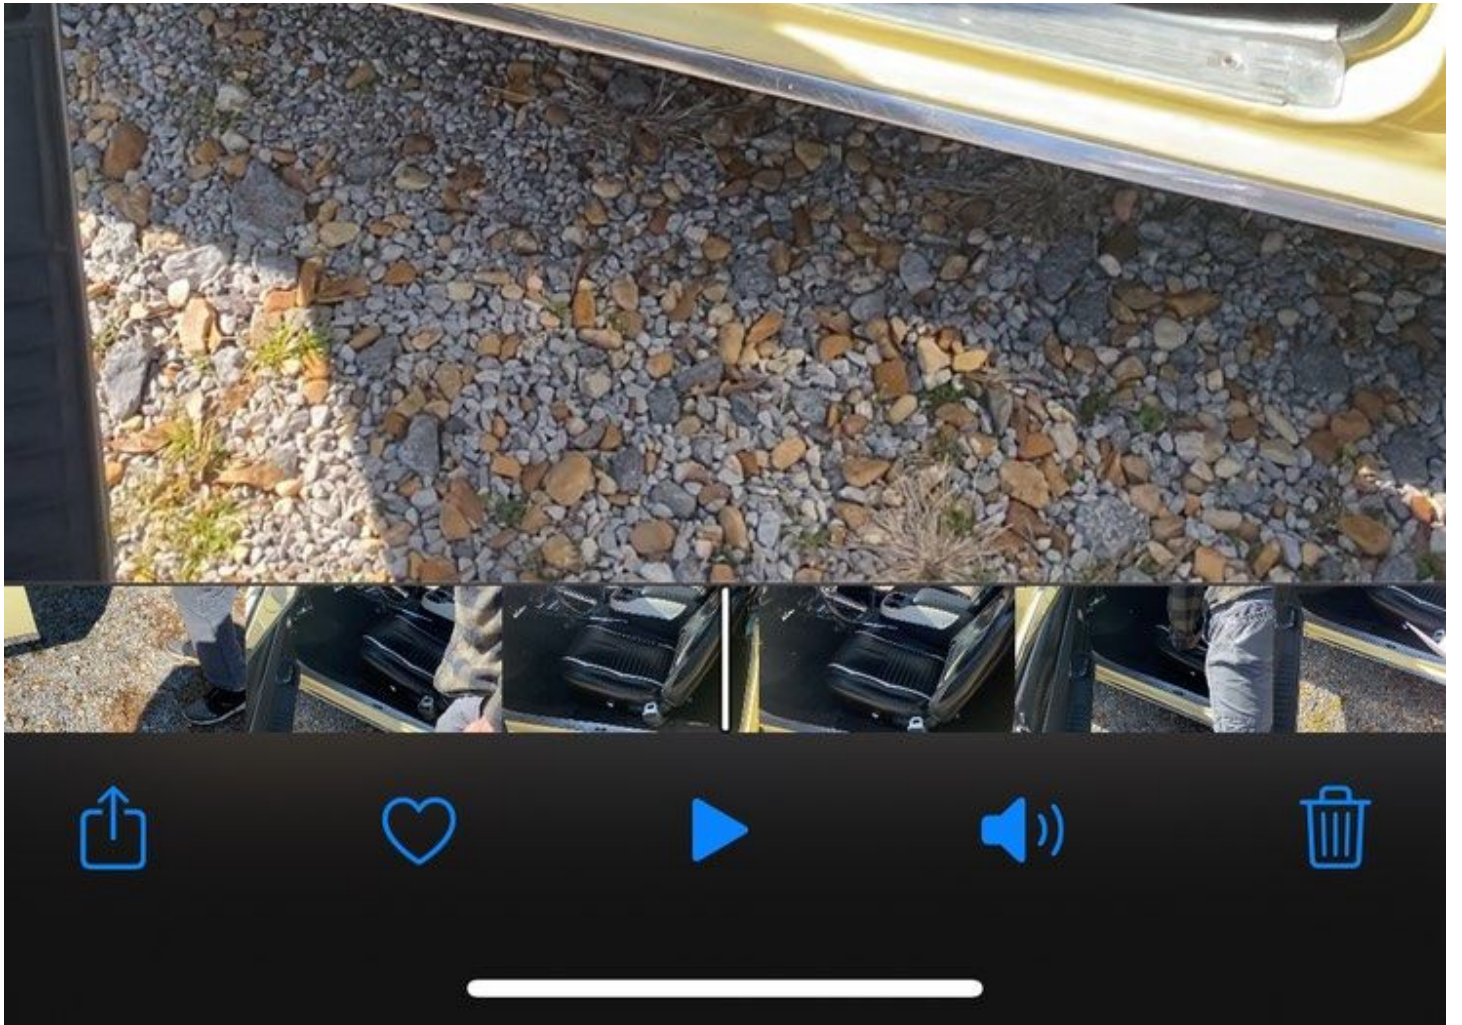



6:27



Today  
1:34 PM

Edit









6:27




Today  
1:34 PM

Edit





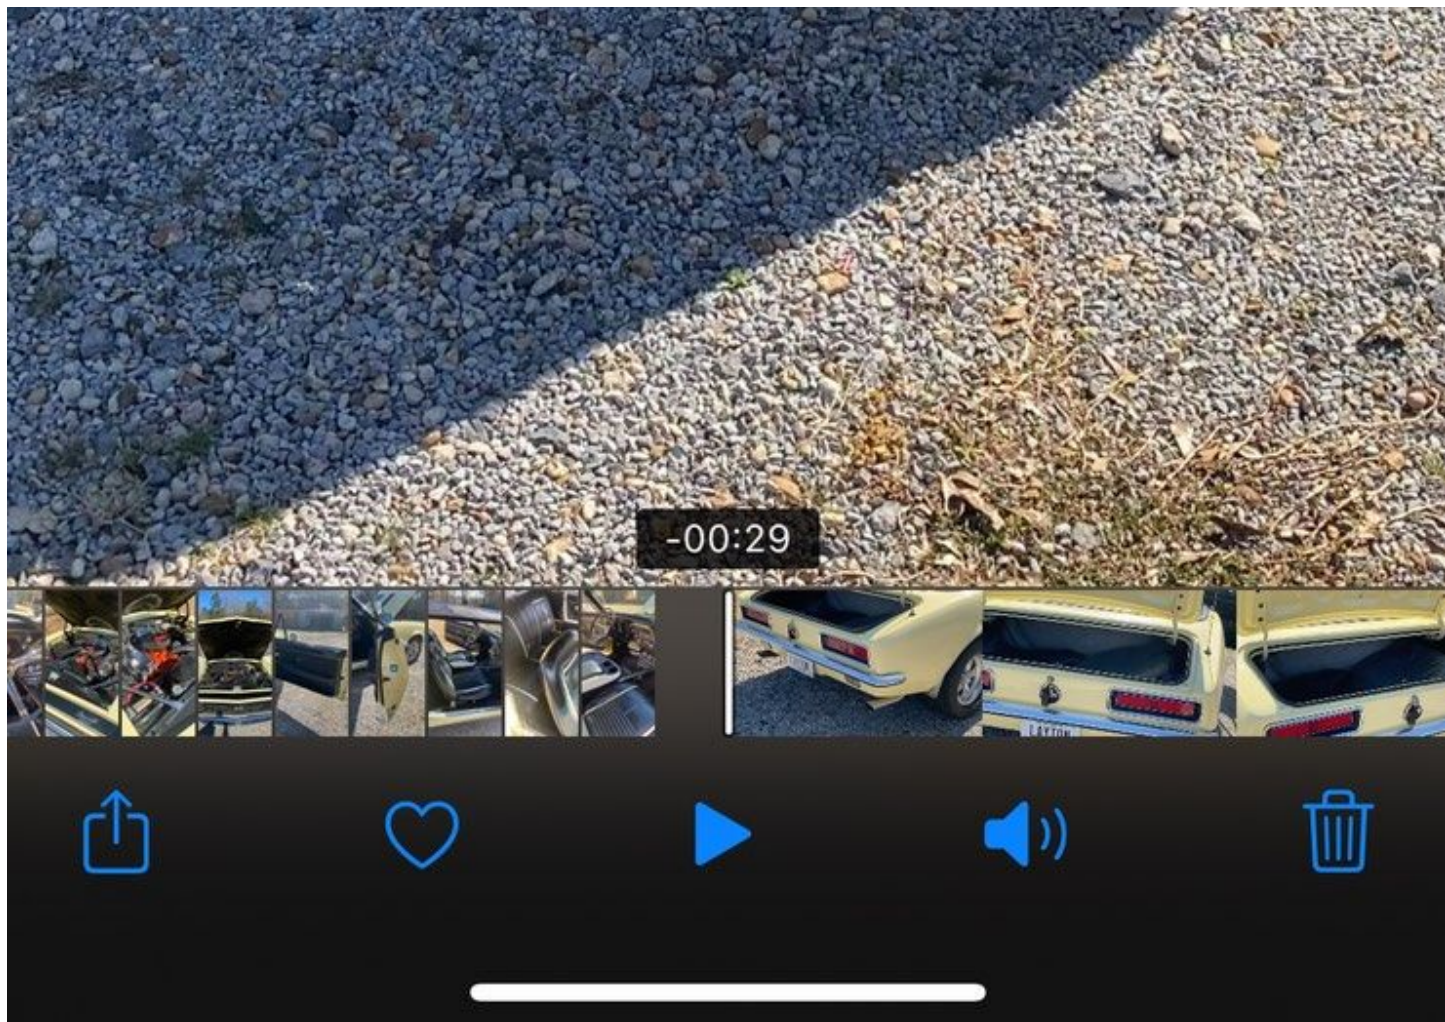



6:26



Today  
1:35 PM

Edit









6:27



Today  
1:34 PM

Edit









6:26



Today  
1:35 PM

Edit

















