

## 1966 Chevrolet C10 Pickup 1/2 Ton



The overall condition of this 1966 Chevrolet C-10 1/2 ton pick-up is in good condition. There are no signs or indications of previously repaired crash damage. This vehicle has little wear and does not present any signs of hard use or abuse.

The overall exterior is clean and looks good. Bodylines and panel gaps are consistent and even throughout. This vehicle was repainted at some point and the vehicle has obviously been garaged. There are minor paint nibs to the left cowl area next to the left fender. The polished wood inlay in the truck bed is in prime condition. No exterior body rust was noted. The chrome trim is in good overall condition. The tires are good in terms of tread depth.

The interior is clean and in good condition as well. Please note that the radio is an aftermarket tape player and is fully functional as well. The interior seats are functional and in good condition just like the carpeting. There is no AC system and the heater does not appear to function.

The undercarriage and chassis have very minor corrosion/rust present with minimal leakage. The condition, however, is still considered in above average condition per the age of the vehicle.

The test drive was very good. The 327cid/4bbl, V-8 engine started promptly and idled well. No abnormal engine noises were observed. Exhaust smoke was unremarkable, and no other signs of issues were noted with overall engine function. Acceleration and performance were good. The 3-speed auto select transmission appeared to have engaged correctly. The power steering and brake systems (drums) operated as expected. The brakes may need adjusting but that it is considered typical as most would update to a powered disc brake system.

The subject vehicle's options and features appeared to function correctly with the only exception of the no heater and non-functioning reverse lights.

This is a decent-looking and running vehicle that shows minimal overall wear.

Vehicle Info	
Year - 1966	
Make - Chevrolet	
Model - C10 Pickup 1/2 Ton	
Mileage - 88076	
Transmission - Automatic	
VIN Number - C1546F160871	
Interior - Cloth	
Interior Color - Grey	
Body Color - Red	
Engine - 8 Cylinder	
Drive Type - Rear Wheel Drive	
Fuel Type - Gas	

Exterior	
Wiper Blades	✓
Windshield Washer	✓
Body Alignment	✓
Scratches	✓
Dings	✓
Dents	✓
Paint Condition	✓
Body Seals	✓
Rust	✓
Exterior Lights	✗
reverse lights - nonfunctional	
Door Mirrors	✓
Bumpers	✓
Frame Damage	✓
Glass	✓
Body Filler?	✓
Hood	✓
Doors	✓
Floors	✓
Rockers	✓
Quarter Panels	✓
Chrome	✓

Interior	
Steering Wheel	✓
Horn	✓
Seat Condition	✓
Seat Belts	✓

Mechanical	
Air Filter	✓
Battery Condition	✓
Charging System	✓
Cooling Fan Condition	✓
Radiator Cap Sealing Properly	✓
Hoses	✓
Radiator	✓
Engine Coolant	✓
Coolant Leaks	✓
Belts	✓
Power Steering	✓
Steering Fluid	✓
Engine Oil	✓
Engine Fluid Leaks	✓
Transmission Fluid	✓
Transmission Leaks	✓
Brake System	✓
Brake Fluid Leaks	✓
Differential leaks	✓
Muffler System	✓
CV Joints and Axles	✓
Shocks and bushings	✓
Ball Joints and Tie Rods	✓


Road Test	
Road Test	✓
Engine Performance	✓
Transmission performance	✓
Differential Performance	✓
Transfer Case Performance	✓
Wheel Bearing Performance	✓
Braking Performance	✗
may need some adjusting	
Suspension Performance	✓
Steering Performance	✓
Engine Starting	✓

TIRES&WHEELS	
Spare Tire	✓
Tire Manufacturer	
Driver's Front - BFGoodrich	
Passenger's Front - BFGoodrich	
Driver's Rear - BFGoodrich	

Clock	✓
Radio/Navigation	✓
Inner Door Panels	✓
Window Function	✓
Center Console	✓
Dash	✓
Sun Visors	✓
Dash Lights	✓
Dash Gauges	✓
Heater	✗
The heater system does not function	
Carpet	✓
Floor Mats	✓
Cigarette Use	✓
Unusual Odors	✓
Blower Motor	✓
Interior Trim	✓

Passenger's Rear - BFGoodrich
<b>Tire Size</b>
Driver's Front - 235/70/15
Passenger's Front - 235/70/15
Driver's Rear - 235/70/15
Passenger's Rear - 235/70/15
<b>Tire Condition</b>
Driver's Front - No Issues
Passenger's Front - No Issues
Driver's Rear - No Issues
Passenger's Rear - No Issues
<b>Wheel Condition</b>
Driver's Front - No Issues
Passenger's Front - No Issues
Driver's Rear - No Issues
Passenger's Rear - No Issues
<b>Tire Tread</b>
Driver's Front - 8/32
Passenger's Front - 8/32
Driver's Rear - 6/32
Passenger's Rear - 6/32



10/32 OR MORE

Tires have plenty of tread!  
(standard)

8/32 OR MORE

Tires have plenty of tread!  
(low profile)

5/32 TO 7/32

Tires will need replacement soon!


4/32 OR LESS


Tires need replacement!


1



2

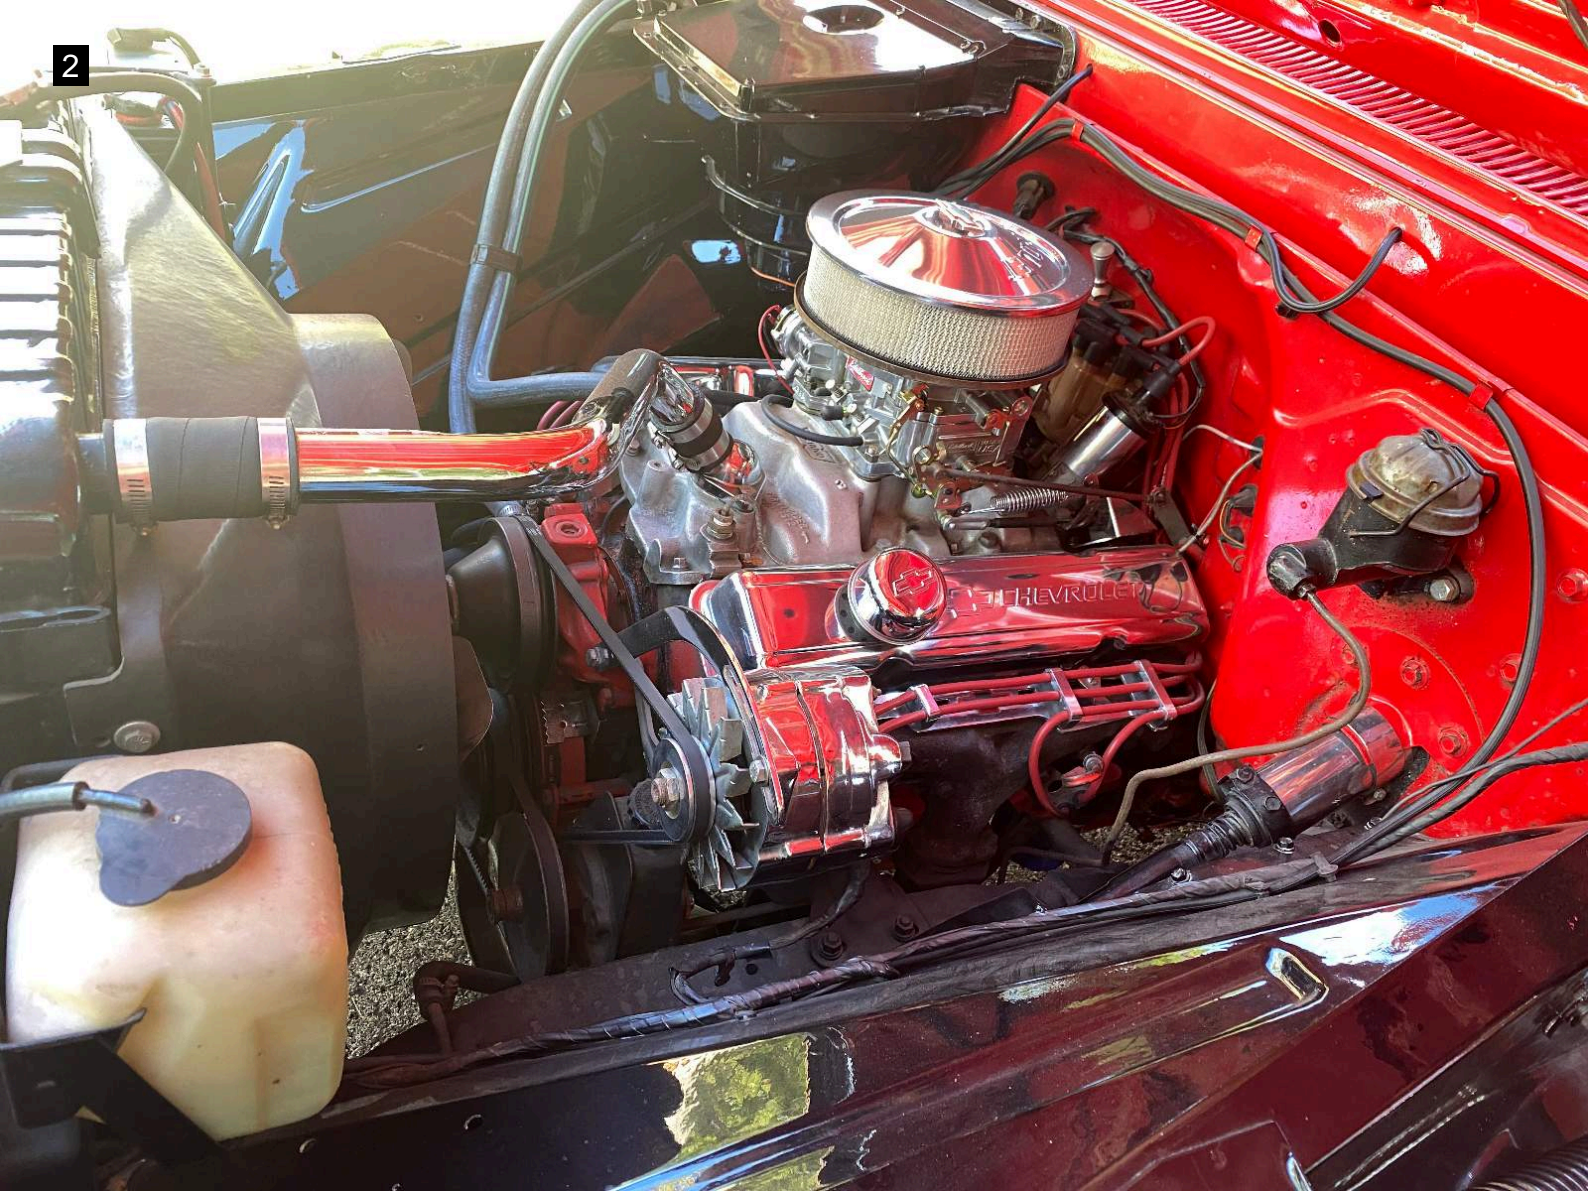


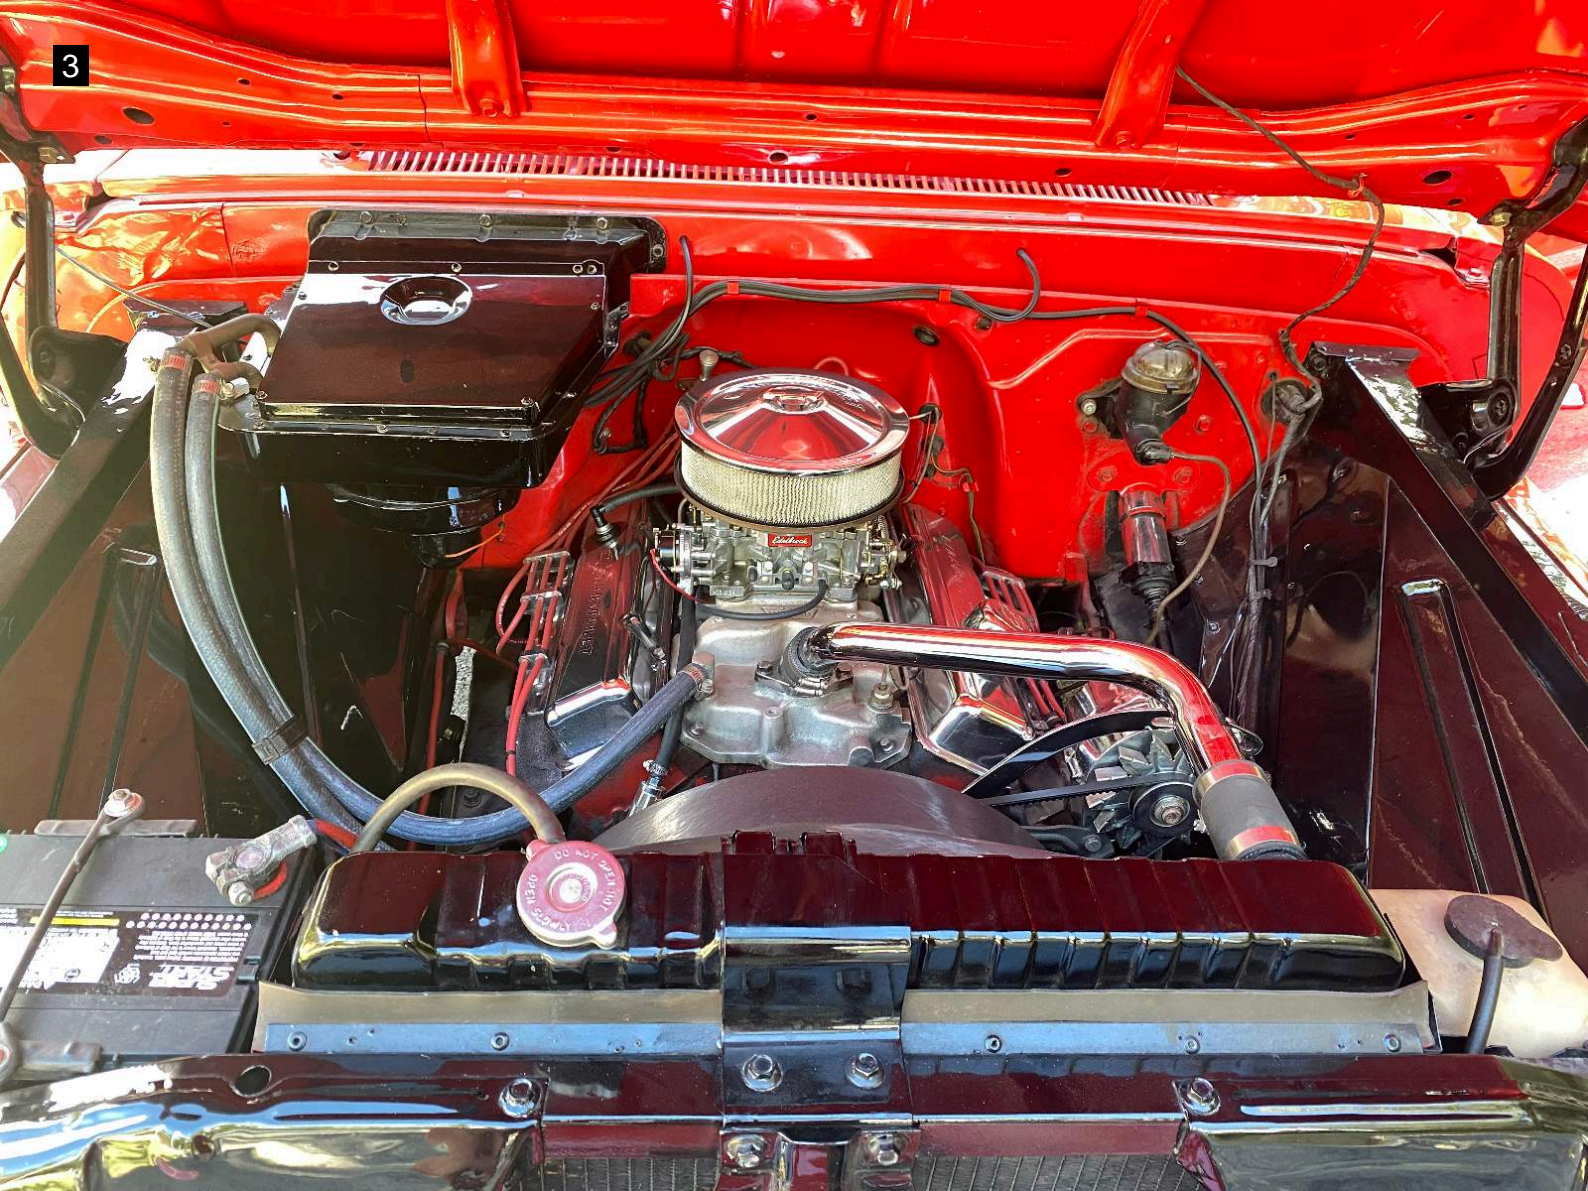

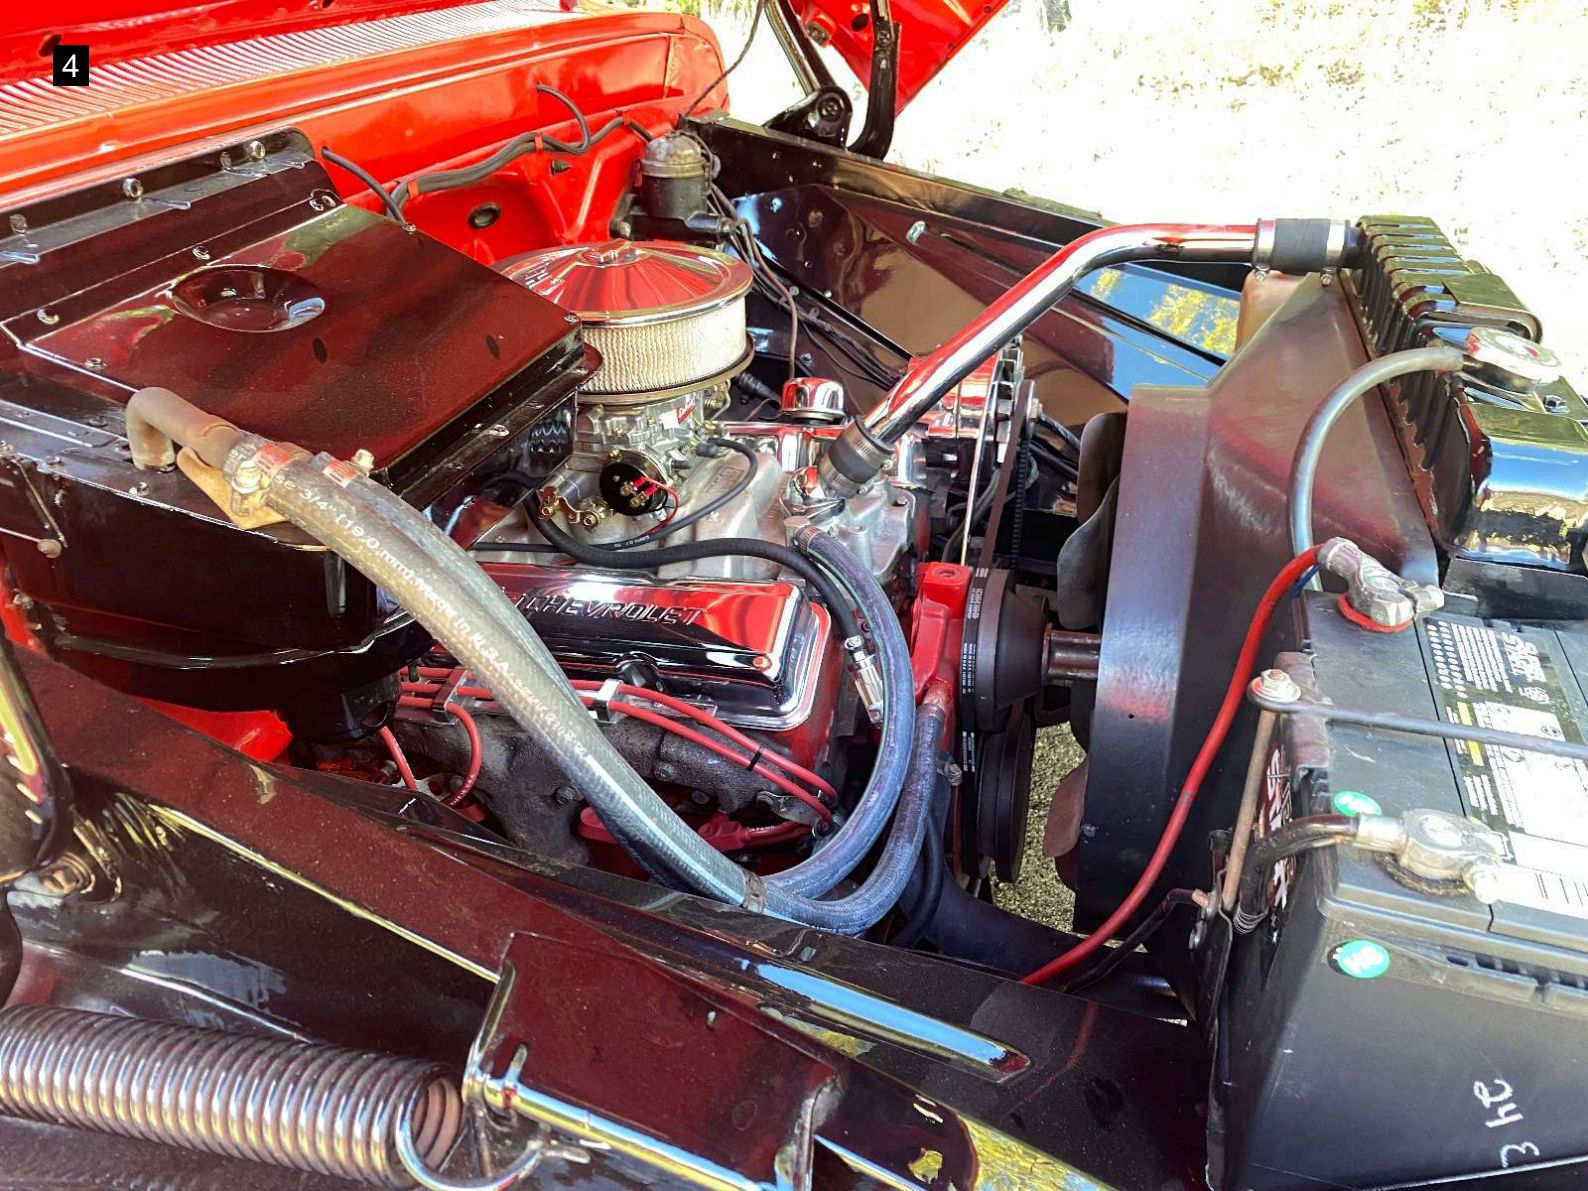

5



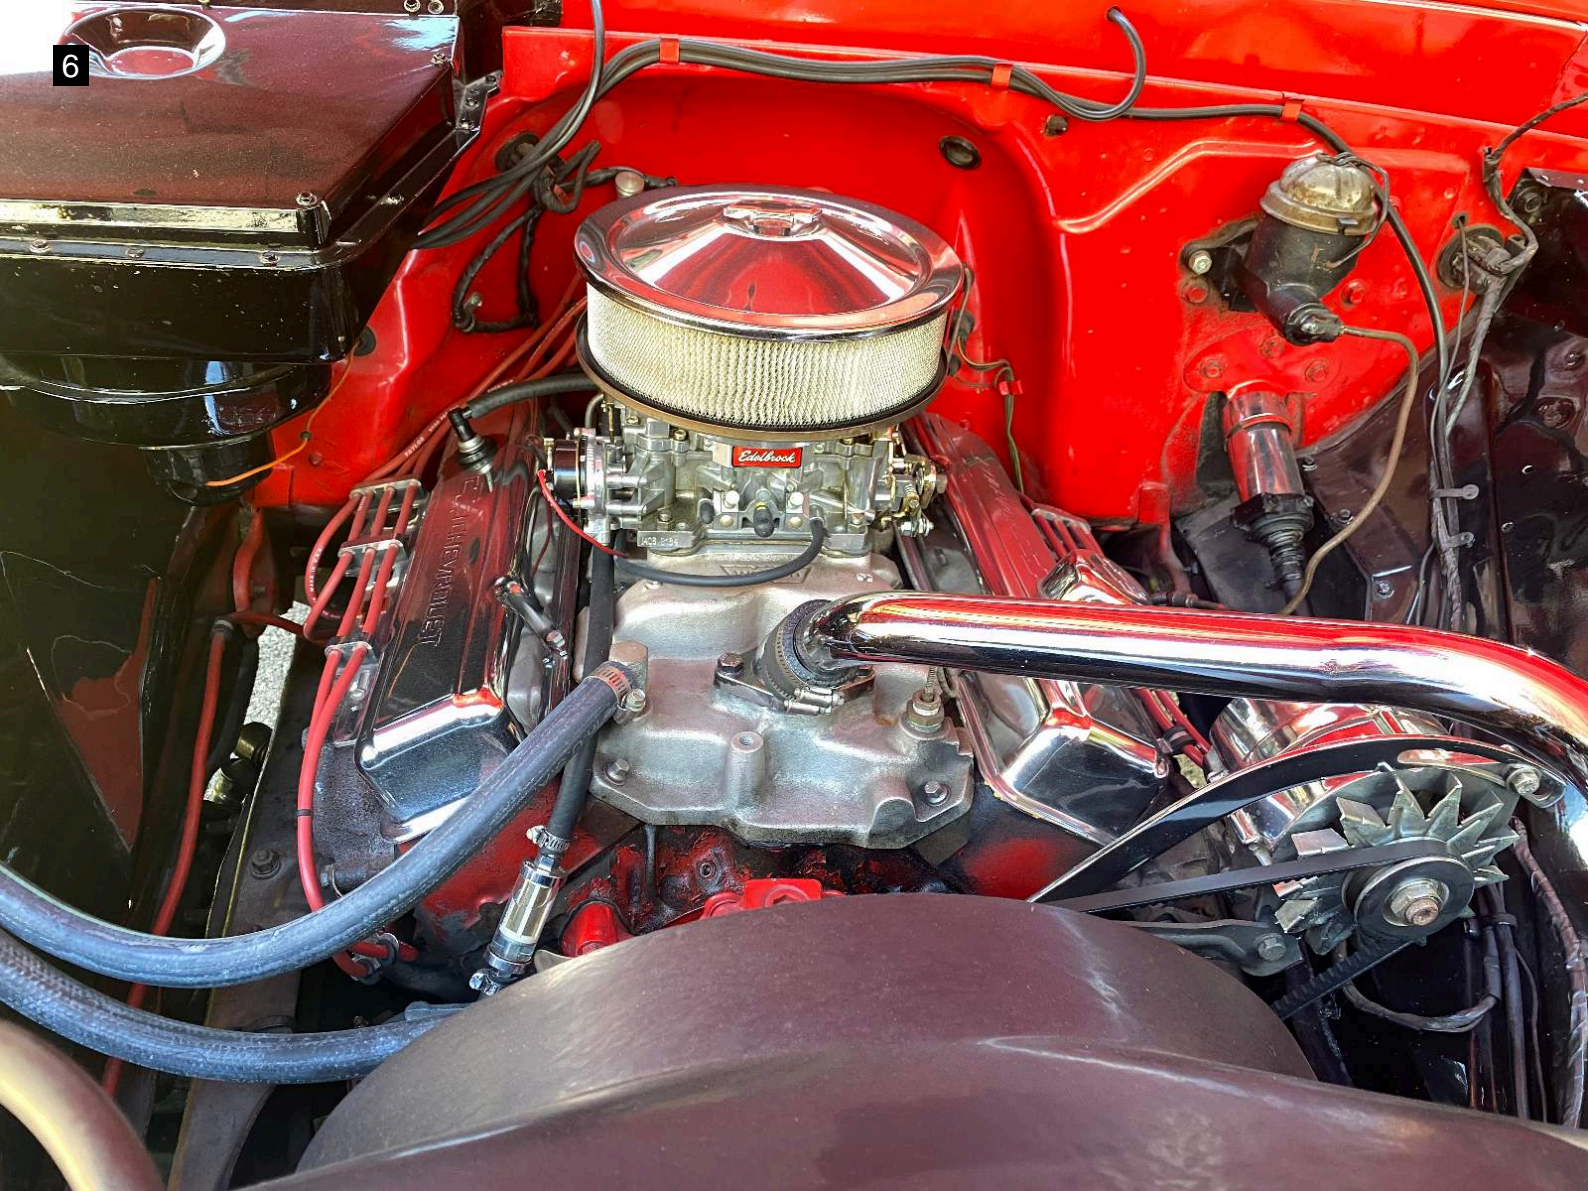

7



## ORIGINAL MOTOR VEHICLE TITLE RECEIPT



2021074130014DG254000140001

2.1

Page 1 of 1

CORNELLIER ANTHONY  
276 MILLWOOD DR  
REEDS SPRING, MO 65737

## OWNER INFORMATION

TELEPHONE: (417) 598-9770  
COUNTY: STONE

OWNER(S)  
CORNELLIER ANTHONY

TRANSFER ON DEATH  
CORNELLIER DIANE

MAKE	YEAR	VEHICLE ID NUMBER	VEHICLE INFORMATION				
CHEV	1966	C1546F160871	KIND OF VEHICLE	BODY STYLE	ODOMETER	ODOMETER CODE	PURCHASE DATE
BRAND CODE			TRUCK	PICKU		EXEMPT	09/11/2021
			FUEL TYPE				
			GASOLINE				

## FEE ASSESSMENT INFORMATION

PURCHASE PRICE	\$25,000.00
OTHER CREDIT AMOUNT	\$14,500.00
NET PRICE	\$10,500.00

## FEE INFORMATION

DESCRIPTION - CODE	AMOUNT
AGENT FEE / AGENT FEE - 0708	\$6.00
TITLING FEE / MOTOR VEHICLE ORIGINAL/NON-NEGOTIABLE/SALVAGE TITLE - 0582	\$8.50
STATE TAX / MOTOR VEHICLE STATE SALES - 0160	\$443.63
LOCAL TAX / STONE COUNTY (SOUTHERN STONE COUNTY FIRE PROTECTION DISTRICT) - 2276	\$236.25
<b>TOTAL PAID:</b>	<b>\$694.38</b>

Any false affidavit is a crime under Section 575.050 of Missouri Law.

This is your title application receipt and proof of lien perfection. Please retain for your records.

## SIGNATURE STATEMENT

SIGNATURE: X

NOTE: The Missouri Department of Revenue may electronically resubmit checks returned for insufficient or uncollected funds. Other restrictions may apply.

## MAIL TITLE TO INFORMATION

CORNELLIER ANTHONY  
276 MILLWOOD DR  
REEDS SPRING, MO 65737

FOR OFFICE USE ONLY





20 30 40 50 60 70 80

880763

























BFGoodrich

COPIED

USED

NEW







FOR ECONOMICAL  
TRANSPORTATION

MANUFACTURED BY  
CHEVROLET DIVISION  
GENERAL MOTORS CORPORATION  
EQUIPMENT AND TIRES FOR GROSS VEHICLE  
WEIGHT RATINGS ARE LISTED IN LOAD  
CAPACITY CHART OF INSTRUCTION BOOKLET  
WARRANTY VOID IF RATING IS EXCEEDED  
MAXIMUM GVW RATING

5000 LB.

CERTIFIED NET H.P. OF ENGINE

95	AT 4000 R.P.M.	(194 CU. IN.)
120	AT 3600 R.P.M.	(230 CU. IN.)
125	AT 3800 R.P.M.	(250 CU. IN.)
153	AT 3600 R.P.M.	(292 CU. IN.)
145	AT 4200 R.P.M.	(283 CU. IN.)
177	AT 4000 R.P.M.	(327 CU. IN.)

TRIM

STD

PAINT

914

WB

CA





































