

Report #497075

1969 Chevrolet Chevelle



Summary

This classic shows well but does exhibit some issues of note. The exterior finish is fair with some minor imperfections noted. Small scuff at right front door. There are minor misc. scratches around the vehicle. Normal for mileage and most too small to see in photos. Clearcoat runs at lower right door & rt front rocker. The vehicle repaint shows dust under the paint, some orange peel, and signs of poor prep. This is sub-par workmanship. Signs of repaired rust at underside of package tray (see images). The underside shows areas of minor surface rust. See pictures. There is a paint chip on the left side rocker panel. The body seals around the windows are showing signs of age and wear. This includes the doors, windows, trunk, and other miscellaneous body seals. Small star crack at center of windshield. The refinishing work is decent but not show quality.

The interior looks complete but there are a few items to mention. There is light wear to the seats. Normal for mileage. The inner door panels show wear consistent with age and mileage. The interior trim shows normal wear consistent with age and mileage. The center console shows wear and tear and is being held together with zip ties. See pictures. The carpet shows normal wear consistent with age and mileage. The accessories are functional.

I found no issues on the test drive. The engine had plenty of power and there were no misfires or smoking. The transmission shifted as designed with no harsh engagement or slipping. The steering was responsive and the suspension was firm and the vehicle handled well. There were no abnormal vibrations or odd noises. The brakes were firm with no pulsation felt. There were no leaks found to the underside of the vehicle. See below and pictures for more info.










Vehicle Information

Year	1969
Make	Chevrolet
Model	Chevelle
VIN	136379K410081
Stock No.	N/A
Mileage	52442
Engine Cylinders	8 Cylinder
Exterior Color	Orange
Interior Color	Black
Interior Material	Vinyl
Engine Number	N/A
Transmission Number	N/A
Fuel Type	Gas





















Drivetrain

Transmission	Automatic
Drive Type	Rear Wheel Drive






















Road Test

Road Test	 Good
Engine Starting Easily	 Good
Engine running well after Started	 Good
Transmission performance	 Good
Differential Performance	 Good
Wheel Bearing Performance	 Good
Braking Performance	 Good
Suspension Performance	 Good
Steering Performance and Alignment	 Good

Exterior

Wiper Blades	 Good
Windshield Washer	 Good
Body Panel Alignment	 Good
Scratches	 Issues
Small scuff at right front door. There are minor misc scratches around the vehicle. Normal for mileage and most too small to see in photos.	
Paint Condition	 Issues
Clearcoat runs at lower right door & rt front rocker. The vehicle repaint shows dust under the paint, some orange peel, and signs of poor prep. This is sub-par workmanship.	
Seals	 Issues
The body seals around the windows are showing signs of age and wear. This includes the doors, windows, trunk, and other miscellaneous body seals.	
Rust	 Issues
Signs of repaired rust at underside of package tray (see images). The underside shows areas of minor surface rust. See pictures. There is a paint chip on the left side rocker panel.	
Exterior Lights	 Good
Power Door Mirrors	 Good
Bumpers	 Good
Underbody/Frame Condition	 Good
Glass	 Issues
Small star crack at center of windshield.	
Floors	 Good
Rockers	 Good
Quarter Panels	 Good
Body Filler Used	 Good
Hood	 Good
Doors	 Good
Dings	 Good
Dents	 Good

Interior























Steering Wheel	 Good
Horn	 Good
Seat Condition	 Issues
There is light wear to the seats. Normal for mileage.	
Seat Belts	 Good
Radio/Navigation/DVD	 Good
Inner Door Panels	 Issues
The inner door panels show wear consistent with age and mileage.	
Center Console	 Issues
The center console shows wear and tear and is being held together with zip ties. See pictures.	
Dash	 Good
Dash Lights Working	 Good
Air Conditioning	 Good
Heater	 Good
Carpet	 Issues
The carpet shows normal wear consistent with age and mileage.	
Floor Mats	 Good
Signs of Smoking?	 Good
Headliner	 Good
Blower Motor	 Good
Instrument Cluster/Gauges	 Good
Unusual Odors	 Good
Window Function	 Good
Interior Trim	 Issues
The interior trim shows normal wear consistent with age and mileage.	
Sun Visors	 Good

Chrome



Good

Mechanical

Air Filter	 Good
Battery Condition	 Good
Charging System	 Good
Cooling Fan Condition Mechanical/Electronic	 Good
Hoses and Clamps Age/Cracking	 Good
Radiator Condition	 Good
Engine Coolant Condition	 Good
Belts	 Good
Power Steering System	 Good
Power Steering Fluid Condition	 Good
Engine Oil Condition	 Good
Engine Oil Leaks	 Good
Transmission Fluid Condition	 Good
Transmission Fluid Leaks	 Good
Brake System Condition	 Good
Brake Fluid Leaks	 Good
Differential leaks	 Good
Muffler System	 Good
Shocks and bushings Condition. Leaking?	 Good
Ball Joints and Tie Rods	 Good
Radiator Cap Sealing Properly	 Good
Coolant Leaks	 Good

Tire / Wheels

Manufacturer	
Driver's Front Tire	El Dorado
Passenger's Front Tire	EL DORADO
Driver's 1st Axle Outer Tire	EL DORADO
Passenger's 1st Axle Outer Tire	EL DORADO
Size	
Driver's Front Tire	215/70R14
Passenger's Front Tire	215/70R14
Driver's 1st Axle Outer Tire	215/70R14
Passenger's 1st Axle Outer Tire	215/70R14
Tire Condition	
Driver's Front Tire	No Issues
Passenger's Front Tire	No Issues
Driver's 1st Axle Outer Tire	No Issues
Passenger's 1st Axle Outer Tire	No Issues
Wheel Condition	
Driver's Front Tire	No Issues
Driver's 1st Axle Outer Tire	No Issues
Passenger's Front Tire	No Issues
Passenger's 1st Axle Outer Tire	No Issues
Tire Tread	
Driver's Front Tire	8/32
Passenger's Front Tire	9/32
Driver's 1st Axle Outer Tire	8/32
Passenger's 1st Axle Outer Tire	8/32
Spare Tire	Yes


Vehicle Images









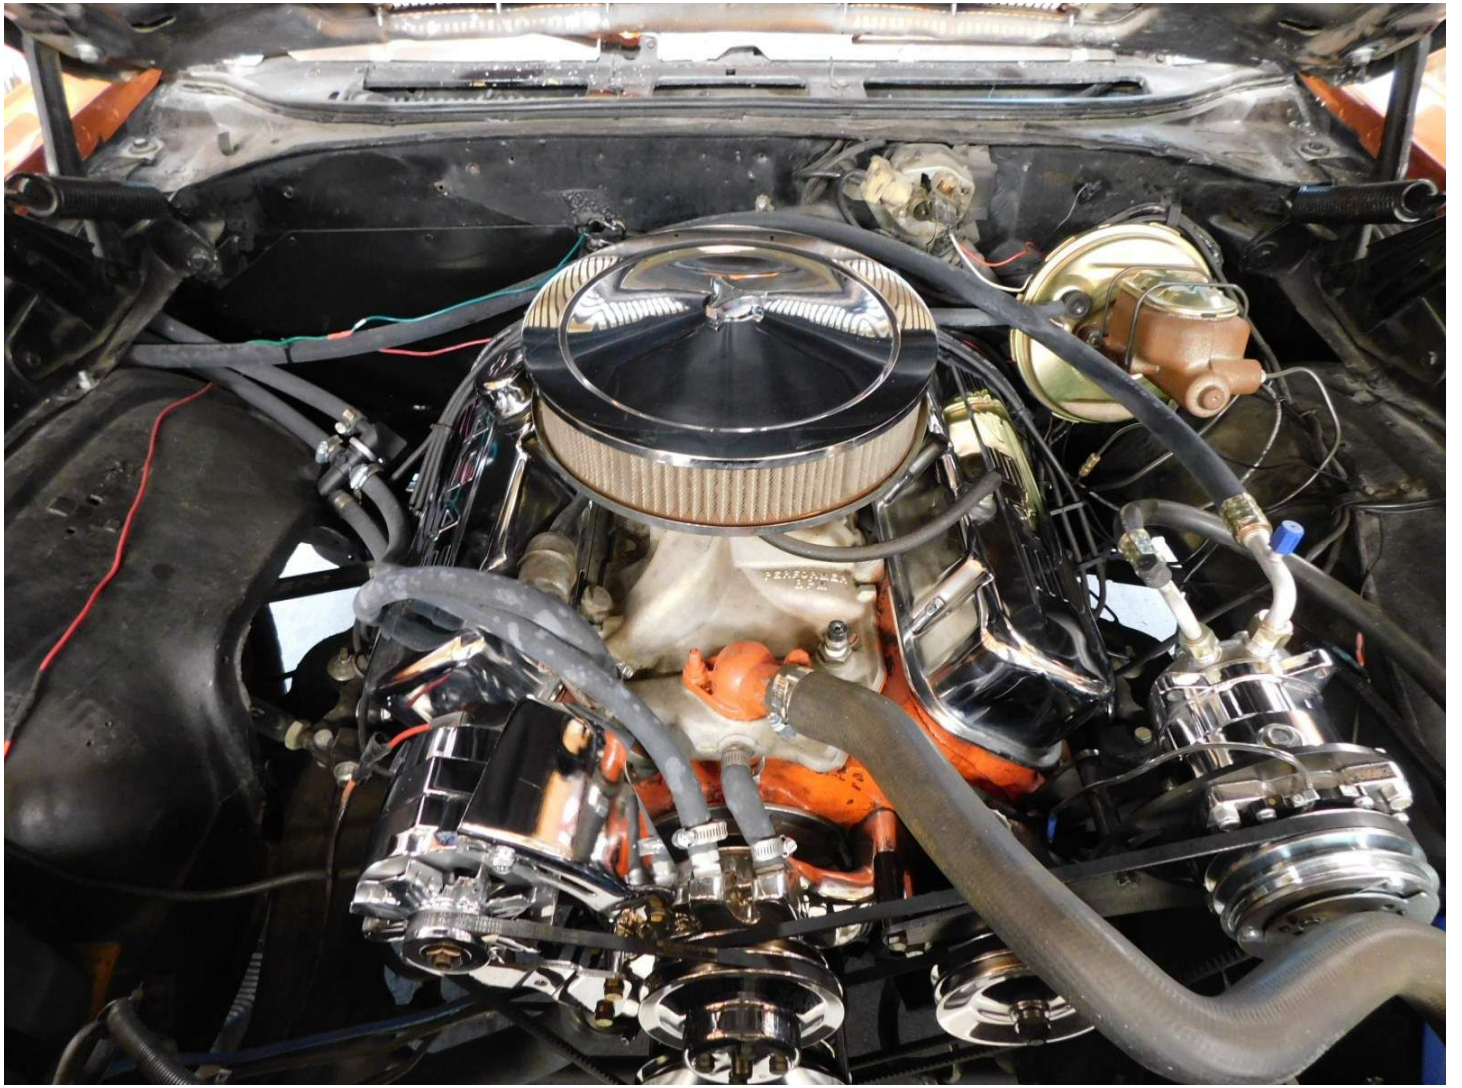







Rt front undercarriage



Left front undercarriage



Left side undercarriage



Left rear undercarriage




Rear differential



Rt rear undercarriage



Right side undercarriage

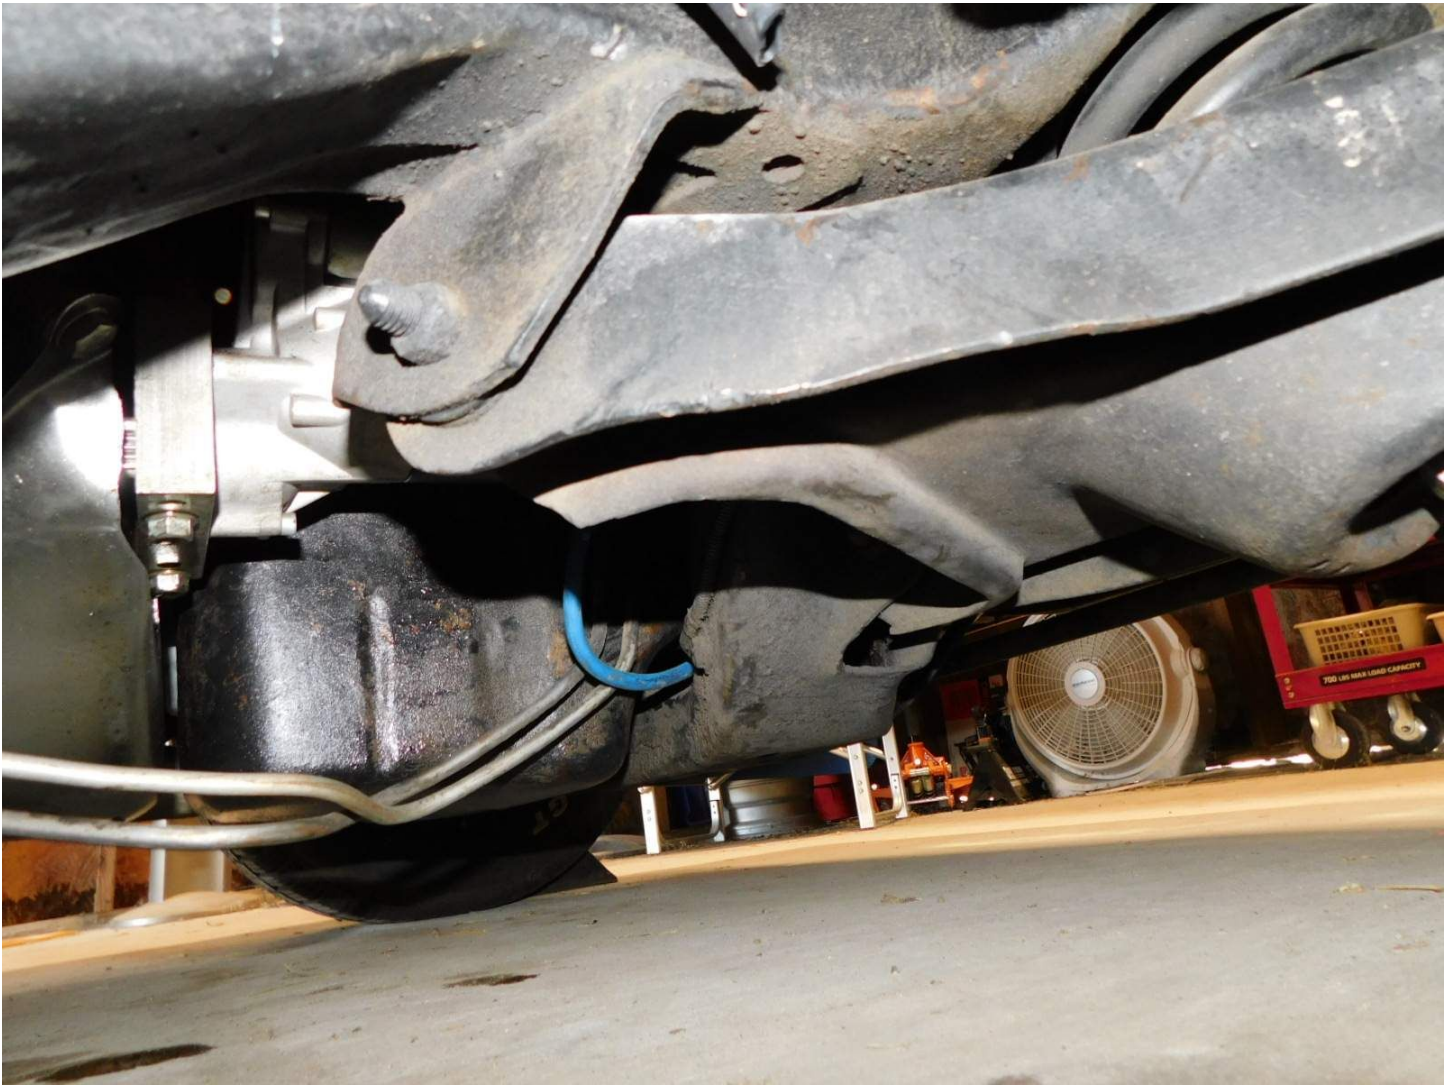

OIL PAN



Package tray underside (rust repair)



Package tray underside (rust repair)



Quarter panel inner, left



Quarter panel inner, right





Rear body panel



VIN AT COWL



TRIM TAG



TRIM TAG



WHEEL L.F



TIRE, L.F



WHEEL, L.R



TIRE, L.R



WHEEL, R.R



TIRE, R.R



WHEEL, R.F



TIRE, R.F



DIPSTICK
























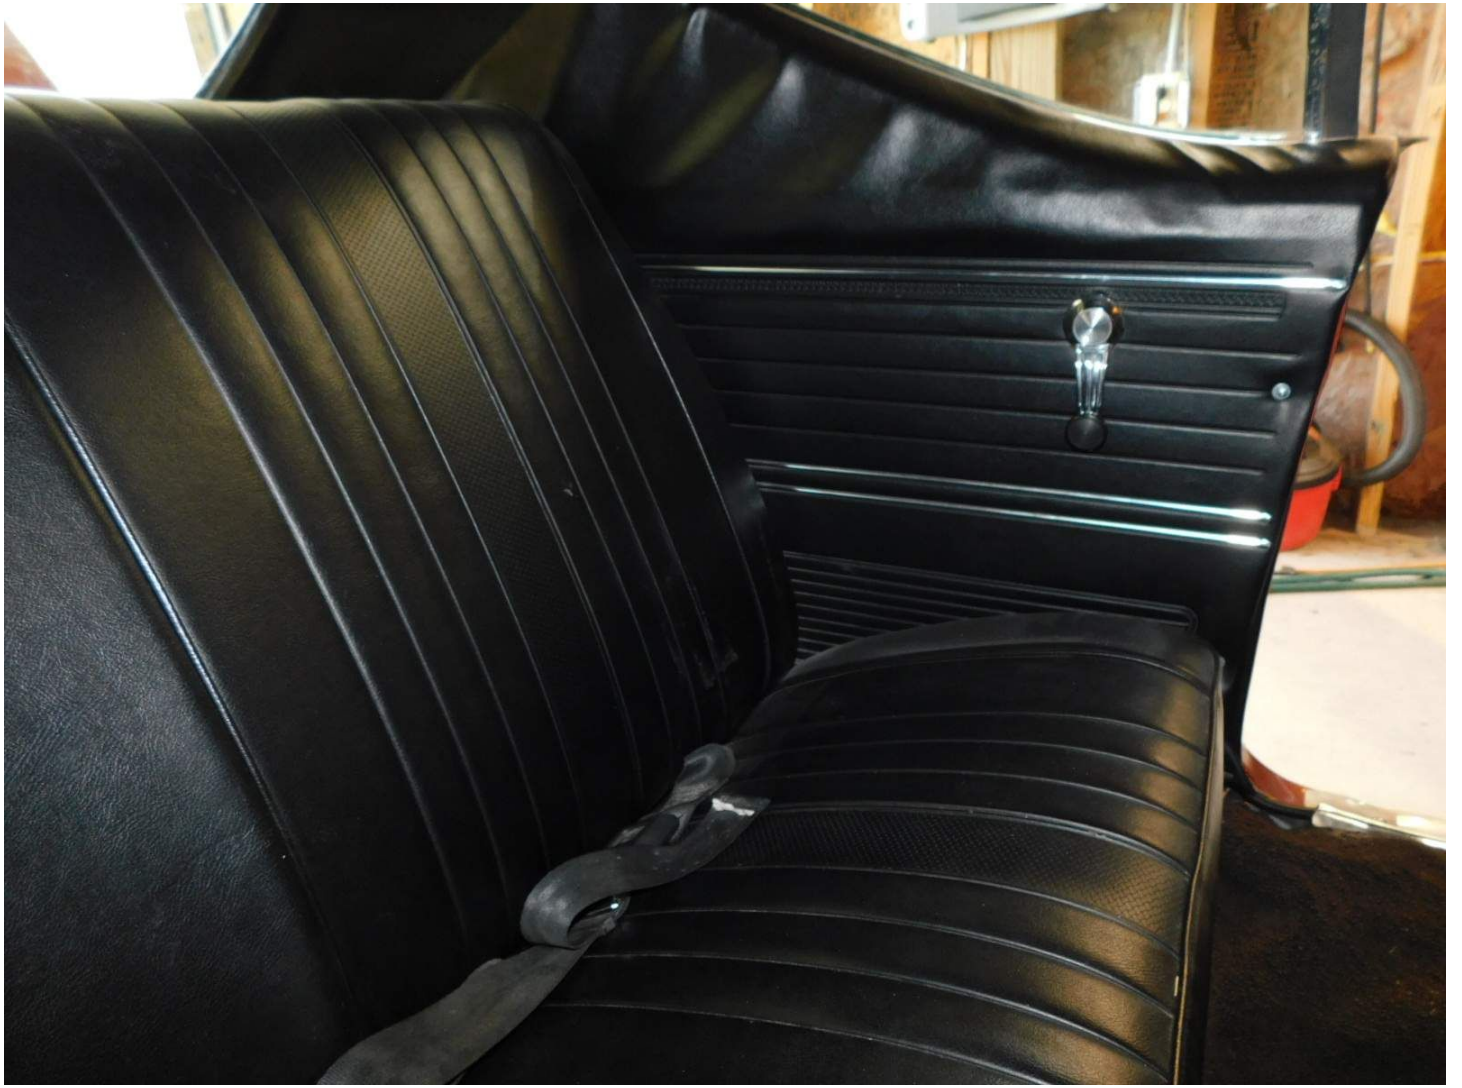



Console, damaged-zip ties used






















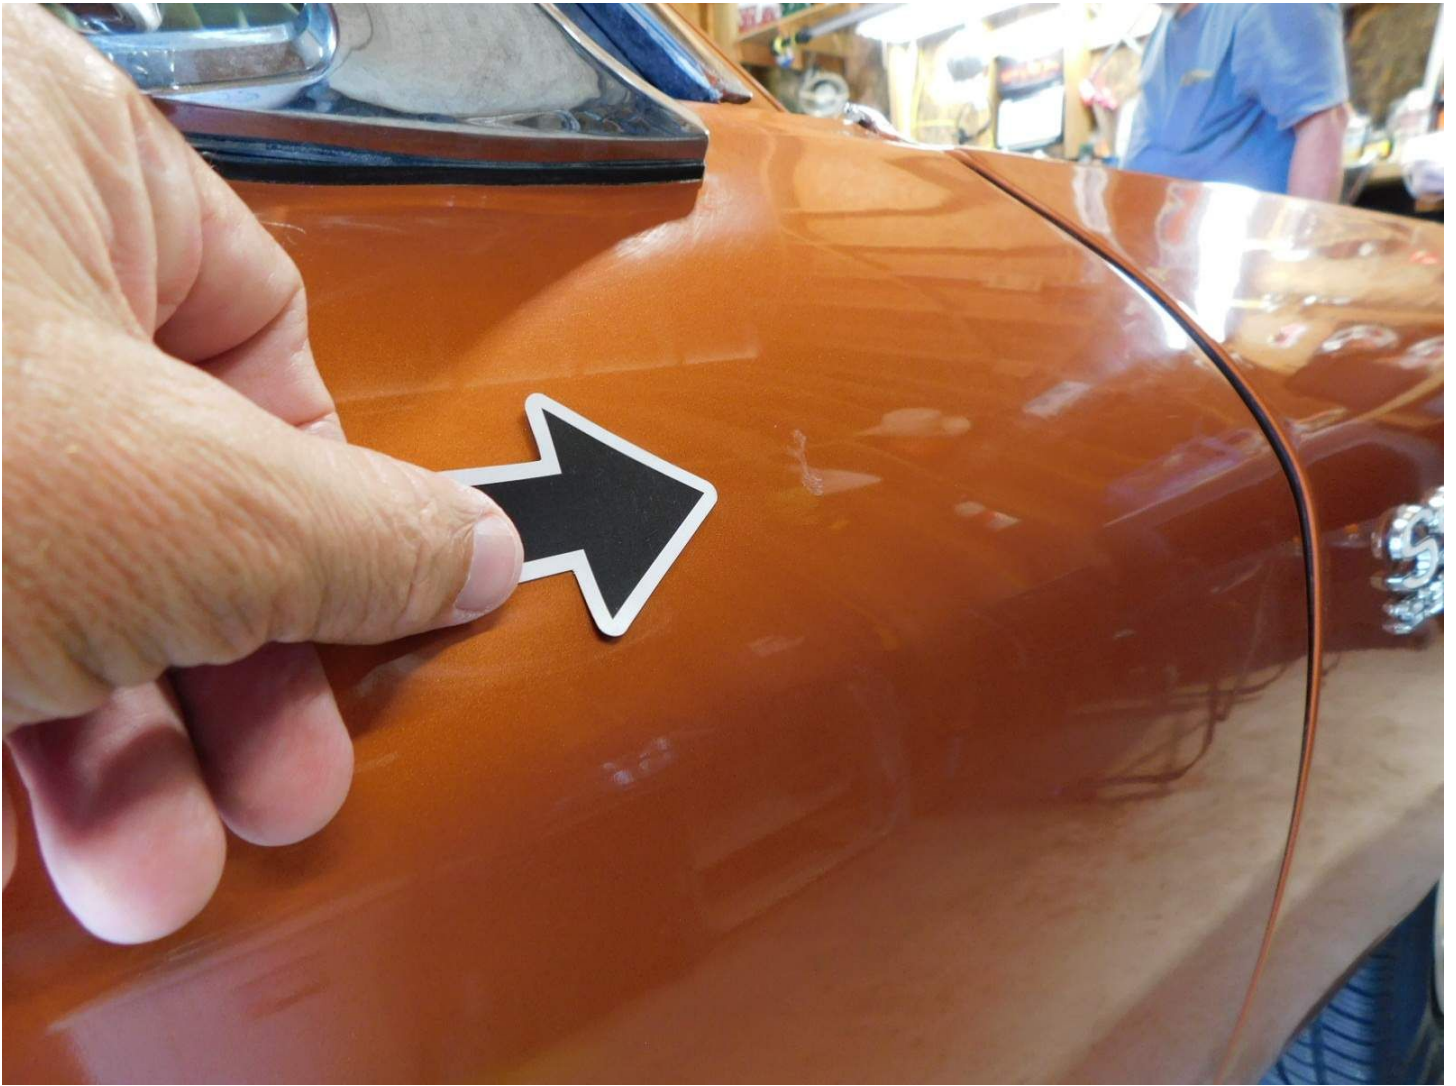

Rt door-scuffed



Clearcoat runs at right rocker



Clearcoat runs at rt door



Left rocker-chipped





















Windshield-star crack @ center